wayfound

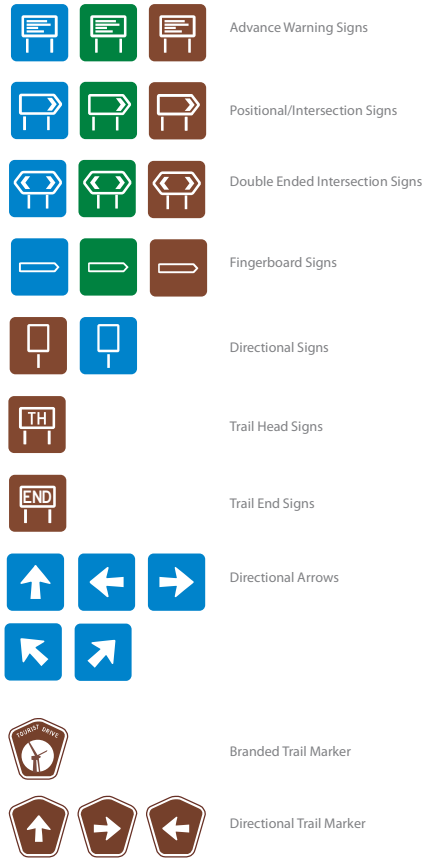
Wayfinding signage audit & Implementation

Wattle Range COUNCIL

Submitted to:
Wattle Range Council

September 2022 - Final

Sign Type Legend



Advance Warning Signs

Positional/Intersection Signs

Double Ended Intersection Signs

Fingerboard Signs

Directional Signs

Trail Head Signs

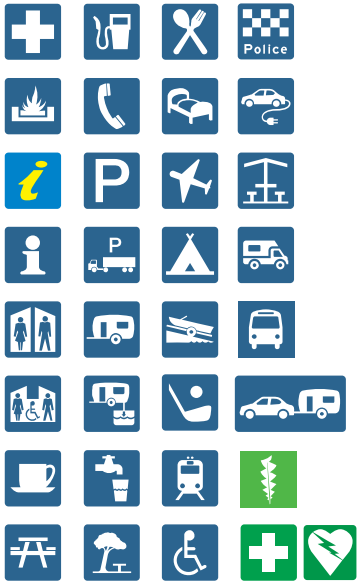
Trail End Signs

Directional Arrows

Branded Trail Marker

Directional Trail Marker

Australian Standard Blue Symbols



Australian Standard Brown Symbols



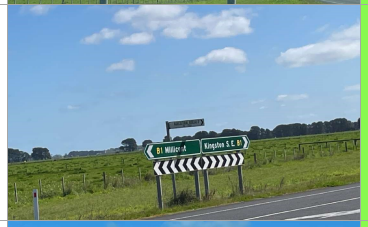
SA Brown Symbols

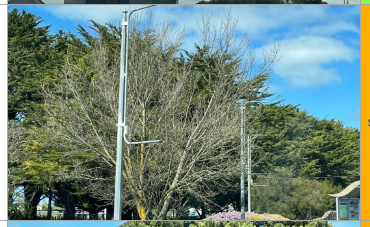
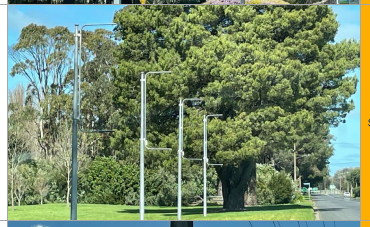


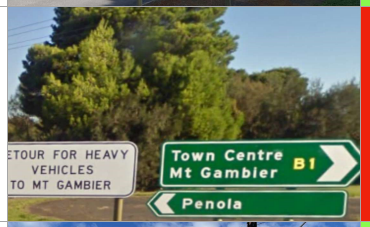
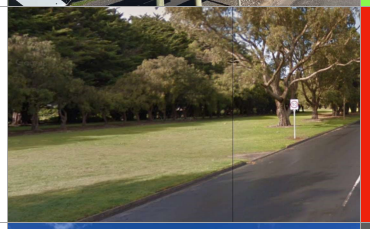
	status	latitude	longitude	sign_type	sign_message	direction	route	intersection_with		sign_action		Symbol/Sign Type		Priority
	Princes Hwy (Southbound)													
1	Various Signs	-37.32116366666670	140.16067266666700	Entry Statement Sign	Wattle Range Council	Southbound	Princes Hwy			Attention needed	• Clean all boundary entry statements anually			High Priority, Ongoing
2	Various Signs	-37.322722	140.16221050000000		Unknown	Southbound	Princes Hwy			Remove sign	• Remove all redundant signage • Refer to page 24 of Strategy			
3	Green Directional Sign	-37.370499833333300	140.20918716666700	Advance Warning Sign	Millicent	Southbound	Princes Hwy			No change				
4	Green Directional Sign	-37.37218197732870	140.21084321065400	Intersection Sign	Penola	Intersection of	Princes Hwy	& Beachport-Penola Rd		No change				
5	Green Directional Sign	-37.371836375608900	140.21055503137600	Intersection Sign	Millicent	Intersection of	Princes HWY	& Beachport - Penola Rd		No change				

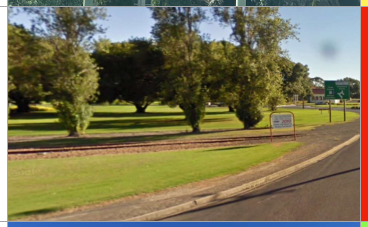
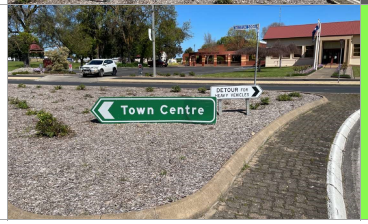
6	Green Directional Sign	-37.3719760099085	140.2104790081470	Intersection Sign	Kingston	Intersection of	Princes Hwy	& Beachport - Penola Rd		No change				
7	Green Directional Sign	-37.37194818275830	140.21034511826700	Intersection Sign	Beachport	Intersection of	Princes Hwy	& Beachport - Penola Rd		No change				
8	Green Directional Sign	-37.37218109391420	140.2108267861010	Advance Warning Sign	Kingston	Northbound	Princes Hwy			No change				
9	Green Directional Sign	-37.37100746143630	140.2123116879590	Directional Sign	Beachport	Westbound	Beachport-Penola Rd			No change				
10	Green Directional Sign	-37.37304236200720	140.2086867596530	Directional Sign	Penola	Eastbound	Beachport-Penola Rd			No change				
11	Various Signs	-37.466771666666700	140.25007566666700		Welcome to Millicent District	Southbound	Princes Hwy			Remove sign	• Remove all redundant signage • Refer to page 24 of Strategy			

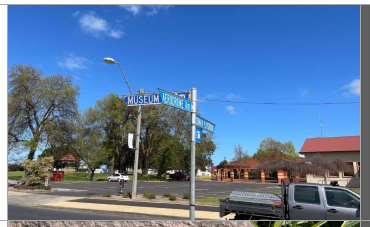
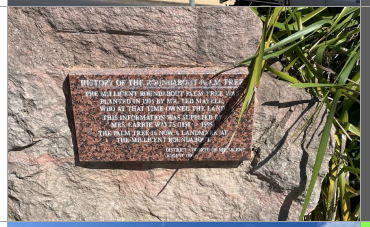
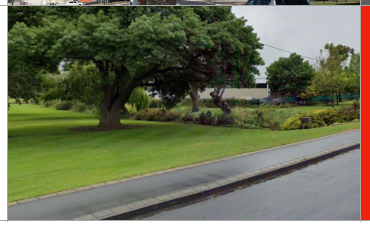
12	Brown Tourist Sign	-37.48679983333330	140.27093250000000	Advance Warning Sign	Golf Course	Southbound	Princes Hwy			Replace sign panel	• Incorrectly signed, golf courses are not tourist attractions • Install Blue Positional sign • Message - Golf Course • Symbol - Golf				High Priority, Ongoing
13	Brown Tourist Sign	-37.4916535	140.2788535	Advance Warning Sign	Golf course	Northbound	Princes Hwy			Replace sign panel	• Incorrectly signed, golf courses are not tourist attractions • Install Blue Positional sign • Message - Golf Course • Symbol - Golf				High Priority, Ongoing
14	Green Directional Sign	-37.4899615	140.2744268333330	Fingerboard Sign	Rendelsham	Intersection of	Princes Hwy	& Main - Coolcoota Tce		Attention needed	• Maintenance Required - straighten sign post				High Priority, Ongoing
15	Blue Services Sign	-37.55913033333330	140.349323	Advance Warning Sign	Millicent 5	Southbound	Princes Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel				High Priority, Ongoing
16	Various Signs	-37.56294416666670	140.353679		Same	Southbound	Princes Hwy			Remove sign	• Remove all redundant signage • Refer to page 24 of Strategy				
17	Various Signs	-37.565658	140.35674483333300	Entry Statement Sign	Welcome to Millicent	Southbound	Princes Hwy			Replace sign panel	• Reskin the existing Millicent , Beachport and Southend billboards. • Develop consistency between billboards as they become due for replacement • Refer to page 62 of Strategy				High Priority, Year 1

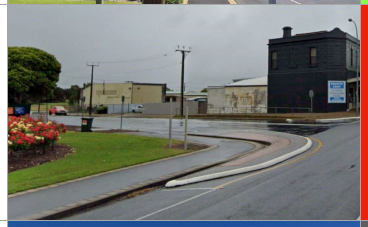
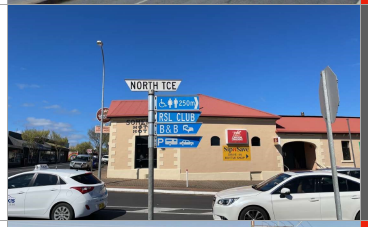
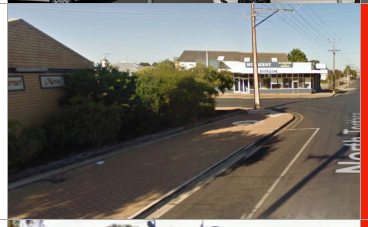
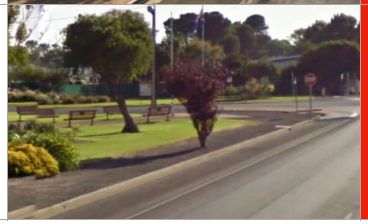
18	Green Directional Sign	-37.566738	140.35775783333300	Advance Warning Sign	Millicent	Southbound	Princes Hwy			No change				
19	Green Directional Sign	-37.5685195	140.35922816666700	Reassurance Sign	Kingston	Northbound	Princes Hwy			No change				
20	Green Directional Sign	-37.570193000000000	140.36026000000000	Intersection Sign	Millicent-Kingston	Southbound	Princes Hwy			No change				
21	Blue Services Sign	-37.581801166666700	140.3573285	Advance Warning Sign	VIB 300m	Southbound	Princes Hwy			No change	• Standardise all visitor information bay road signage • Refer to diagram on page 69 of Strategy			Medium Priority, Year 2
	Princes Hwy (Southbound)													
	Princes Hwy (Millicent													
22	Various Signs	-37.58496728643810	140.3564997688120	Entry Statement Sign	Welcome to Millicent	Southbound	Princes Hwy			Attention needed				Medium Priority, Year 2
23	Various Signs	-37.584979289086700	140.35656263127700		None	Southbound	Princes Hwy			Replace sign panel	• Refurbish, repaint and re-sign structures. • Standardise all visitor information bay road signage • Refer to page 67 of Strategy			High Priority, Year 1

24	Blue Services Sign			Positional Sign	VIB	Northbound	Princes Hwy			Replace sign panel	• Standardise all visitor information bay road signage • Refer to diagram on page 69 of Strategy			Medium Priority, Year 2
25	Green Directional Sign	-37.58434106186780	140.35642081959000	Reassurance Sign	Kingston	Northbound	Princes Hwy			No change				
26	Various Signs	-37.58449717570210	140.356514635073	Tourist Information	None	Southbound	Princes Hwy			Replace sign panel	• Look at some alternative products that would have great visual effect but be less labour intensive when it comes to change out. • Recommend changing to internal halyard flag poles • Refer to page 62 of Strategy			Low Priority, Year 3
27	Various Signs	-37.58607925324930	140.35603680993100	Tourist Information	None	Southbound	Princes Hwy			Replace sign panel	• Look at some alternative products that would have great visual effect but be less labour intensive when it comes to change out. • Recommend changing to internal halyard flag poles • Refer to page 62 of Strategy			Low Priority, Year 3
28	Blue Services Sign	-37.58763630404760	140.35542298720500	Advance Warning Sign	VIB 150m	Northbound	Princes Hwy			Replace sign panel	• Standardise all visitor information bay road signage • Refer to page 69 of Strategy			Medium Priority, Year 2
29	Green Directional Sign	-37.58911856079660	140.35508734132500	Advance Warning Sign	Town Centre	Southbound	Princes Hwy			No change				

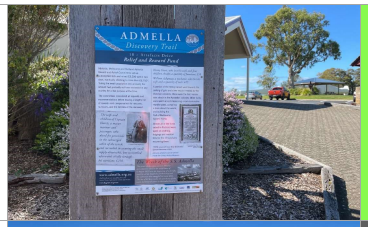
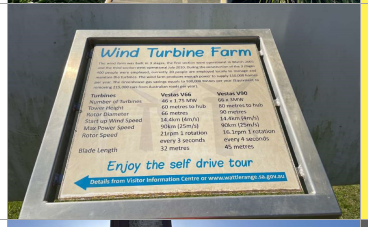
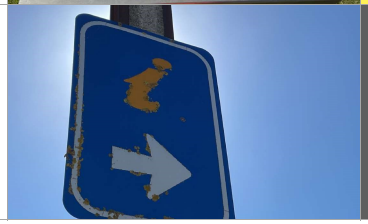
30	Green Directional Sign	-37.591075387556400	140.35476834063000	Intersection Sign	Kingston	Intersection of	Princes Hwy	& MB Rd		No change					
30A	Blue Services Sign	-37.59130322238320	140.35452494400500	Intersection Sign	Services	Intersection of	Princes Hwy	& MB Rd		New Sign	• Install new blue intersection sign below existing green panel structure. • Blue service symbols to include Visitor Ctr, Meals, Accomodation.			High Priority, Year 1
31	Green Directional Sign	-37.59130322238320	140.35452494400500	Intersection Sign	Town Centre	Intersection of	Princes Hwy	& MB Rd		No change					
31A	Blue Services Sign			Advance Warning Sign	Services	Intersection of	Princes Hwy	& MB Rd		New Sign	• New blue town services advance warning sign. • Blue service symbols to include Visitor Ctr, Meals, Accomodation.			High Priority, Year 1
32	Blue Services Sign	-37.591340895365800	140.35428378180200	Advance Warning Sign	Services	Intersection of	Princes Hwy	& MB Rd		Remove sign	• Wrong location this sign to be replaced by sign 31A				
33	Green Directional Sign	-37.5910930182618	140.35472952660400	Advance Warning Sign	Town Center	Westbound	Mt Burr Rd			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 of Strategy				High Priority, Ongoing

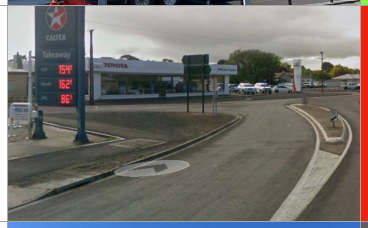
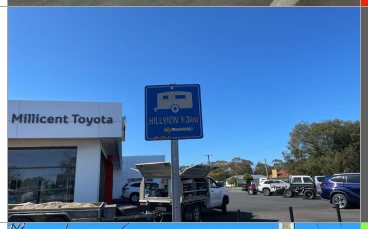
34	Green Directional Sign	-37.5913334431317	140.35278436300100	Advance Warning Sign	Penola	Eastbound	Princes Hwy			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 of Strategy			High Priority, Ongoing
	Blue Services Sign	-37.59206400175940	140.35140554388700	Advance Warning Sign	Various	Southbound	Princes Hwy			New Sign	• Caravan Advance Warning Sign. • Top section - Hillside CP and Car/Caravan Parking symbol • Bottom section - Lakeside CP • Refer to page 52 of Strategy			High Priority, Year 1
35	Green Directional Sign	-37.59206400175940	140.35140554388700	Advance Warning Sign	Beachport	Southbound	Princes Hwy			No change				
35A	Blue Services Sign	-37.59206400175940	140.35140554388700	Advance Warning Sign	Various	Southbound	Princes Hwy			New Sign	• New blue town services advance warning sign. • Blue service symbols to include Visitor Ctr, Meals, Accomodation. • Additional Panel with Police & Hospital symbols			High Priority, Year 1
36	Blue Services Sign	-37.5922659857849	140.35087962169800	Intersection Sign	Various	Southbound	Princes Hwy			Remove sign	• Remove all sign structures at this location. (Replaced by sign 41)			
37	Green Directional Sign	-37.592598993042600	140.3507492831210	Intersection Sign	Town Center	Southbound	Princes Hwy			No change				

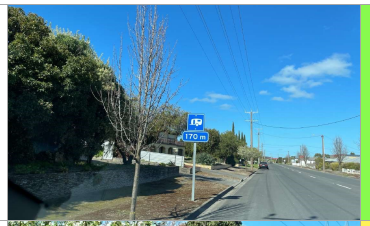
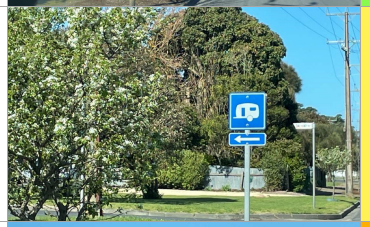
38	Blue Services Sign	-37.59270360922190	140.35072623790600	Directional Sign	Various	Southbound	Princes Hwy			Remove sign	• Remove all signs at this location. Signs too small and poorly positioned			
39	Interpretive Sign	-37.592709312708300	140.35047431844600	Interpretive Sign	Roundabout Palm Tree	Southbound	Princes Hwy			Remove sign	• Interpretive plaque for an attraction that no longer exists			
40	Green Directional Sign	-37.5925563613958	140.35018573569800	Directional Sign	Kingston	Intersection of	Princes Hwy	& Beachport Rd		No change				
41	Green Directional Sign	-37.59249595240480	140.35031696966700	Intersection Sign	Penola	Intersection of	Princes Hwy	& Southern Ports Hwy		Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 of Strategy			High Priority, Ongoing
42	Blue Services Sign	-37.59330171629560	140.35140244303300	Advance Warning Sign	Visitor Center 600m	Southbound	Princes Hwy			Remove sign	• Remove all signs at this location. Signs too small and poorly positioned			High Priority, Year 1
42A	Various Signs	-37.59329201759710	140.35142309621200	Tourist Information		Southbound	Princes Hwy			New Sign	• New blue/brown advance warning sign. • Blue panel symbols to include Visitor Ctr, car/ caravan parking. • Brown panel Museum			High Priority, Year 1

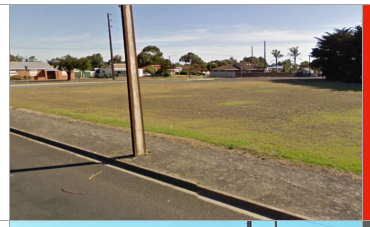
43	Various Signs	-37.59329201759710	140.35142309621200	Tourist Information	Millicent Gallery	Southbound	Princes Hwy			Remove sign	Remove old banner				
44	Green Directional Sign	-37.593519560462200	140.35138708688000	Advance Warning Sign	Beachport	Northbound	Princes Hwy			No change					
44A		-37.59366600137590	140.35160377947500	Intersection Sign	Canunda NP	Intersection of	Princes Hwy	& North Tce		New Sign	• Double sided Brown intersection sign. • Message - Canunda NP, Lake Bonney, Windfarm Tourist Dr (Double sided). • Double sided Blue intersection sign Message -- Toilets, Car Caravan Parking (Double sided). • Symbols Tourist Dr, Toilets, Car Caravan Park			High Priority, Year 1
45	Blue Services Sign	-37.59366600137590	140.35160377947500	Fingerboard Sign	Various	Intersection of	Princes Hwy	& North Tce		Remove sign	• Remove all signs at this location, Too small, wrong location				
45A	Brown Tourist Sign	37.594318	140.350477	Trailhead Sign	Windfarm Tourist Dr	Westbound	North Tce			New Sign	• Install Brown Trailhead sign • Message - Windfarm Tourist Drive, Canunda NP, Lake Bonney • Symbol - Tourist Dr			High Priority, Year 1
45B	Brown Tourist Sign	37.594318	140.350477	Trail Marker	Windfarm Tourist Dr	Eastbound	North Tce			New Sign	• Install Brown Trail End sign • Message - End • Symbol - Tourist Dr			High Priority, Year 1

46	Various Signs	-37.59348572824280	140.35170528389100	Tourist Information	Millicent Guide	Southbound	Princes Hwy			No change					
47	Blue Services Sign	-37.59633467105200	140.35597400812100	Advance Warning Sign	Visitor Center	Southbound	Princes Hwy			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 71 of Strategy				Medium Priority, Year 2
48	Various Signs	-37.59750120982430	140.35712748789700	Tourist Information	Millicent Guide	Southbound	Princes Hwy			No change					
48A	Brown Tourist Sign	-37.59741024116150	140.3571177170570	Advance Warning Sign	Museum	Southbound	Princes Hwy			New Sign	• Install Brown Advance Warning signs • Message - Living History Museum • Install Blue Advance Warning sign • Symbols - VC Yellow "I", Car/Caravan Parking, RV Dump Point, Toilets.			High Priority, Year 1
49	Brown Tourist Sign	-37.59741024116150	140.3571177170570	Intersection Sign	Museum	At Location	Princes Hwy			New Sign				High Priority, Year 1
49A	Brown Tourist Sign	-37.59741024116150	140.3571177170570	Advance Warning Sign	Museum	Northbound	Princes Hwy			New Sign	• Install Brown Advance Warning signs • Message - Living History Museum • Install Blue Advance Warning sign • Symbols - VC Yellow "I", Car/Caravan Parking, RV Dump Point, Toilets.			High Priority, Year 1

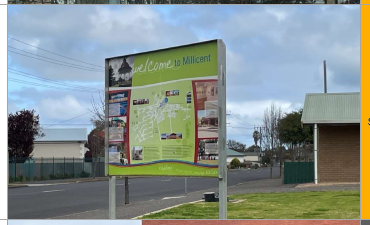
50	Interpretive Sign	-37.59750949091760	140.35719651522000	Interpretive Sign	Admella Wreck	At Location	Princes Hwy			No change				
51	Blue Services Sign	-37.59764612313590	140.35731442601200	Intersection Sign	Caravan Parking	Southbound	Princes Hwy			Remove sign	• This sign replaced by new sign at Sign 49 • • Refer to page 54 of WRC Strategy			High Priority, Year 1
52	Various Signs	-37.59745453555610	140.35739252841600	Tourist Information	Melbourne Adelaide Touring Route	At Location	Princes Hwy			No change				
53	Interpretive Sign	-37.59752580425430	140.35774439045000	Interpretive Sign	Ash Wednesday	At Location	Princes Hwy			Attention needed	Clean sign			High Priority, Ongoing
54	Interpretive Sign	-37.597449020778200	140.35795074705400	Interpretive Sign	Wind Turbine Farm	At Location	Princes Hwy			Attention needed	Clean sign			High Priority, Ongoing
55	Blue Services Sign	-37.60453614875450	140.360089363661	Advance Warning Sign	Visitor Center	Northbound	Princes Hwy			Remove sign	This sign replace by new sign at Site 51			Medium Priority, Year 2

56	Green Directional Sign	-37.60422171865860	140.3599079244660	Intersection Sign	Town Center	Northbound	Princes Hwy			No change					
57	Green Directional Sign	-37.604162077157000	140.36003738625000	Intersection Sign	My Gambier	Southbound	Princes Hwy			No change					
57A	Blue Services Sign	-37.60427092755320	140.3601911497690	Advance Warning Sign	Caravan Park	Southbound	Williams Rc			New Sign	• Install Blue directional sign • Message - None • Symbol - Caravan				High Priority, Year 1
58	Blue Services Sign	-37.60427092755320	140.3601911497690	Directional Sign	Hill view 1.3 km	Southbound	Princes Hwy			Remove sign	Remove sign, wrong location, past the decision making point. (This sign replaced by 57A)				
59	Green Directional Sign	-37.60509423178110	140.3611212979440	Reassurance Sign	Mt Gambier	Southbound	Princes Hwy			No change					
60	Green Directional Sign	-37.605597500000000	140.36172316666700	Advance Warning Sign	Kingston	Northbound	Princes Hwy			No change					

61	Blue Services Sign	-37.6113645	140.36921583333300	Advance Warning Sign	Caravan park 170m	Southbound	Princes Hwy			No change					
62	Blue Services Sign	-37.61225766666670	140.37028683333300	Directional Sign	Caravan park	Intersection of	Princes Hwy	& Dalton St		Attention needed	Clean Sign				High Priority, Ongoing
63	Blue Services Sign	-37.612814577331400	140.37083437679400	Advance Warning Sign	Caravan parks	Northbound	Princes Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel				High Priority, Year 1
64	Various Signs	-37.624691597391900	140.38278171248400	Entry Statement Sign	Welcome to Millicent	Northbound	Princes Hwy			No change					Medium Priority, Year 2
65	Green Directional Sign	-37.60338516666670	140.35840983333300	Advance Warning Sign	Southend	Northbound	Williams Rc			No change					
66	Green Directional Sign	-37.59615016666670	140.34425100000000	Advance Warning Sign	Beachport	Northbound	Williams Rc			No change					

66A	Brown Tourist Sign	-37.59615016666670	140.34425100000000	Intersection Sign	Windfarm Tourist Dr Canunda NP Lake Bonney	Intersection of	Williams Rc	& Iossie Rd		New Sign	• Brown double sided intersection sign. • Windfarm Tourist Dr, Canunda NP, Lake Bonney. • Refer to page 28 of Strategy.			High Priority, Year 1
67	Various Signs	-37.59615016666670	140.34425100000000	Fingerboard Sign	Tasting Room	Intersection of	Williams Rc	& Iossie Rd		Remove sign	• Remove sign at this location - Replaced by new blue fingerboard at 66A			
67A	Blue Services Sign	-37.593448978759100	140.33837046715900	Advance Warning Sign	Caravan park	Northbound	Williams Rc			New Sign	• Install Blue Directional Sign • Message - 100m • Symbol - Caravan Park			High Priority, Year 1
68	Blue Services Sign	-37.593448978759100	140.33837046715900	Directional Sign	Caravan park	Intersection of	Williams Rc	& park Tce		Attention needed	Clean Sign			High Priority, Ongoing
68A	Blue Services Sign	-37.593448978759100	140.33837046715900	Advance Warning Sign	Caravan park	Southbound	Williams Rc			New Sign	• Install Blue Directional Sign • Message - 100m • Symbol - Caravan Park			High Priority, Year 1
69	Brown Tourist Sign	-37.588048324884700	140.32789627260300	Advance Warning Sign	Lake McIntyre 1km	Northbound	Williams Rc			Replace sign panel	• Replace faded and damaged panel			High Priority, Year 1

70	Green Directional Sign	-37.586134392803100	140.32406352473500	Advance Warning Sign	Beachport	Northbound	Williams Rc			No change				
71	Green Directional Sign	-37.58635828612740	140.32469630509900	Reassurance Sign	Mt Gambier 52	Southbound	Williams Rc			Attention needed	• Cut back trees			High Priority, Ongoing
71A	Blue Services Sign	-37.5944132514394	140.35040982228200	Advance Warning Sign	Car/caravan parking	Southbound	Williams Rc			New Sign	• Install Blue Directional Sign • Message - None • Symbol - Car/Caravan Parking			High Priority, Year 1
71B	Brown Tourist Sign	-37.5944132514394	140.35040982228200	Advance Warning Sign	Windfarm Tourist Dr	Southbound	Williams Rc			New Sign	• Install Brown Directional Sign • Message - None • Symbol - Windfarm Tourist Dr			High Priority, Year 1
72	Brown Tourist Sign	-37.59675334211220	140.3456477635920	Intersection Sign	Canunda NP	Intersection of	Williams Rc	& North Tce		Replace sign panel	• Replace Brown Intersection Sign • Message - Windfarm Tourist Dr, Canunda NP, Lake Bonney			High Priority, Year 1
72A	Blue Services Sign	-37.5944132514394	140.35040982228200	Advance Warning Sign	Car/caravan parking	Northbound				New Sign	• Install Blue Directional Sign • Message - None • Symbol - Car/Caravan Parking			High Priority, Year 1

73	Blue Services Sign	-37.5944132514394	140.35040982228200	Fingerboard Sign	Car/caravan parking	Westbound	North Tce			Replace sign panel	• Replace Blue Fingerboard Sign • Message - None • Symbol - Car/Caravan Parking			High Priority, Year 1
74	Various Signs	-37.594641740391200	140.34945287952700	Tourist Information	Map	At Location	North Tce			Replace sign panel	• Refurbish, repaint and re-sign structures. • Standardise all visitor information bay road signage			High Priority, Year 1
75	Blue Services Sign	-37.59293778900070	140.3492032123590	Directional Sign	Visitor Center	Intersection of	Ridge Tce	& Main St		Remove sign	• Remove all signs at this location, replace with sign at 75A			
75A	Blue Services Sign	-37.59293778900070	140.3492032123590	Intersection Sign	Visitor Centre/ Hospital	Intersection of	Ridge Tce	& Main St		New Sign	Install new blue intersection sign below existing green panel structure. Blue service symbols to include Visitor Ctr, Meals, & Accomodation			High Priority, Year 1
76	Green Directional Sign	-37.593034845945700	140.34934179196500	Intersection Sign	Beachport	Intersection of	Ridge Tce	& Main St		New Sign	Install new blue intersection sign below existing green panel structure. Blue service symbols - caravan park, swimming lake			High Priority, Year 1
77	Blue Services Sign	-37.59300046369050	140.34895408014500	Directional Sign	Caravan park	Intersection of	Ridge Tce	& Main St		Remove sign	Remove sign, wrong location, past the decision making point.			High Priority, Year 1

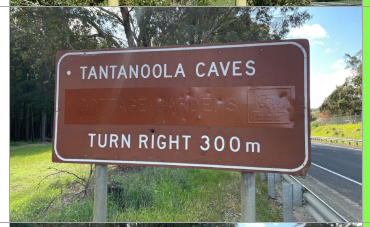
78	Blue Services Sign	-37.592822076791200	140.34872294083700	Directional Sign	Caravan park	Intersection of	Main St	Park Tce		Replace sign panel	• Replace sign with Australian standard Caravan symbol			High Priority, Year 1
79	Brown Tourist Sign	-37.589179479321200	140.34146037458700	Intersection Sign	Rendelsham Rd	Intersection of	Main St	& Park Tce		Remove sign	• Review all institutions with brown tourist signs to determine if they are lawful and meet DIT &TICSA guidelines eligibility criteria and are they properly signed. • Replace damaged and faded signs.			High Priority, Year 1
80	Blue Services Sign	-37.588060401943800	140.33940191500800	Directional Sign	Caravan park	Southbound	Southern Ports Hwy			Replace sign panel	• Replace sign with Australian standard Caravan symbol			High Priority, Year 1
81	Blue Services Sign	-37.586967938623500	140.33497867115200	Directional Sign	Visitor Center 2.2km	Southbound	Southern Ports Hwy			Attention needed	Clean Sign			High Priority, Ongoing
82	Brown Tourist Sign	-37.58628528661780	140.32952281017800	Advance Warning Sign	Lake McIntyre 1km	Northbound	Southern Ports Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel			High Priority, Year 1
83	Blue Services Sign	-37.58524295346110	140.3226100977740	Directional Sign	Caravan parks	Intersection of	Southern Ports Hwy	& Williams St bypass		Remove sign	Remove sign, wrong location, past the decision making point.			High Priority, Year 1

84	Green Directional Sign	-37.585189773549800	140.32309248916200	Intersection Sign	Beachport	Intersection of	Southern Ports Hwy	& Williams Rd		No change					
85	Green Directional Sign	-37.58509106608850	140.32263493450000	Intersection Sign	Mt Gambier	Southbound	Southern Ports Hwy			New Sign	New Blue Service Sign - Caravan Park (Replaces Sign 83)			High Priority, Year 1
86	Brown Tourist Sign	-37.585127265227700	140.32172120189300	Advance Warning Sign	Lake McIntyre	Northbound	Southern Ports Hwy			No change				Medium Priority, Year 2
87	Various Signs	-37.584900032676300	140.32060648653200	Tourist Information	Explore	Southbound	Southern Ports Hwy			Replace sign panel	• Look at some alternative products that would have great visual effect but be less labour intensive when it comes to change out. • Recommend changing to internal halyard flag poles • Refer to page 62 of Strategy			Low Priority, Year 3
88	Various Signs	-37.58486748574110	140.32123111364400	Entry Statement Sign	Welcome to Millicent	Southbound	Southern Ports Hwy			No change				Medium Priority, Year 2
89	Various Signs	-37.58480274058860	140.32135170172100	Tourist Information	Welcome to Millicent	Southbound	Southern Ports Hwy			Replace sign panel	• Refurbish, repaint and re-sign structures. • Standardise all visitor information bay road signage			High Priority, Year 1

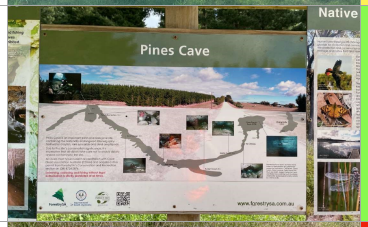
90	Brown Tourist Sign	-37.585028410976500	140.32212688690300	Advance Warning Sign	Millicent Attractions	Southbound	Southern Ports Hwy			No change				
91	Various Signs	-37.58428518451480	140.31910683452000	Tourist Information	Lake McIntyre	Eastbound	Saleyards Rd			Replace sign panel	• Replace faded directional signs for Lake McIntyre Reserve. • Develop a standard sign set for all WRC parks and recreation area.			Medium Priority, Year 2
92	Various Signs	-37.584026594011700	140.31944839767500	Entry Statement Sign	Welcome to Lake McIntyre	Eastbound	Saleyards Rd			Replace sign panel	• Replace faded directional signs for Lake McIntyre Reserve. • Develop a standard sign set for all WRC parks and recreation area.			Medium Priority, Year 2
93	Various Signs	-37.583331162711300	140.31649359642500	Interpretive Sign	Interp Center	At Location	Southern Ports Hwy			Replace sign panel	• Replace faded directional signs for Lake McIntyre Reserve. • Develop a standard sign set for all WRC parks and recreation area.			Medium Priority, Year 2
94	Green Directional Sign	-37.58463223162250	140.31946232805500	Advance Warning Sign	Town Center	Southbound	Southern Ports Hwy			No change				
	Princes Hwy (Millicent														
	Princes Hwy (Southbound)														
95	Blue Services Sign	-37.63152933333330	140.38940016666700	Advance Warning Sign	Millicent 5	Northbound	Princes Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel			High Priority, Year 1

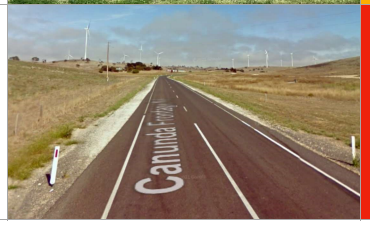
96	Blue Services Sign	-37.635355	140.39189316666700	Regulatory Sign	Road Watch Area	Northbound	Princes Hwy			Remove sign	• Remove all redundant signage • Refer to page 24 of Strategy			High Priority, Ongoing
97	Green Directional Sign	-37.66810533333330	140.42870750000000	Advance Warning Sign	My Gambier	Southbound	Princes Hwy			No change				
98	Brown Tourist Sign	-37.668102166666700	140.42928783333300	Advance Warning Sign	Various	Southbound	Princes Hwy			No change				
99	Brown Tourist Sign	-37.668102429772500	140.4307811603160	Intersection Sign	Tantanoola	Intersection of	Princes Hwy	& Tantanoola Rd		Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads.			High Priority, Ongoing
100	Green Directional Sign	-37.668098070316200	140.43357005959900	Reassurance Sign	Mt Gambier	Southbound	Princes Hwy			No change				
101	Green Directional Sign	-37.66809180382420	140.4335746822320	Intersection Sign	Millicent	Intersection of	Princes Hwy	& Ag Rd		No change				

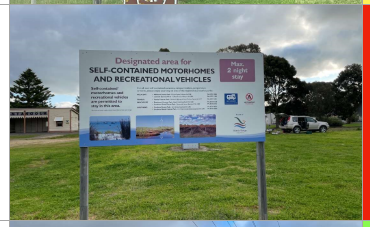
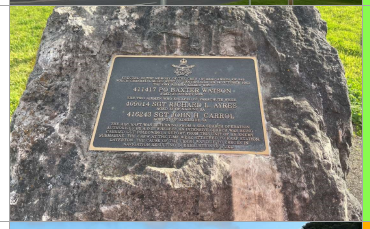
102	Green Directional Sign	-37.66821928869660	140.43844050240300	Advance Warning Sign	Millicent	Northbound	Princes Hwy			No change					
103	Various Signs	-37.66823205421220	140.4361128066530	Entry Statement Sign	Welcome to Millicent	Northbound	Princes Hwy			Replace sign panel	• Reskin the existing Millicent , Beachport and Southend billboards. develop consistency between billboards as they become due for replacement • Refer to page 62 of Strategy				High Priority, Year 1
104	Green Directional Sign	-37.67825883333330	140.47341966666700	Advance Warning Sign	Mt Gambier	Southbound	Princes Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel				Low Priority, Year 3
105	Green Directional Sign	-37.679293666666700	140.47586916666700	Intersection Sign	Tantanoola	Intersection of	Princes Hwy	& Kennedy Rd		No change					
106	Green Directional Sign	-37.683002	140.483447	Advance Warning Sign	Mt Gambier	Southbound	Princes Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel				Low Priority, Year 3
107	Green Directional Sign	-37.68324216666670	140.48396300000000	Intersection Sign	Glencoe	Intersection of	Princes Hwy	& Glencoe Rd		Replace sign panel	• Panel faded and damaged • Replace sign panel				Low Priority, Year 3

108	Green Directional Sign	-37.68549405933650	140.48761794243000	Advance Warning Sign	Millicent	Northbound	Princes Hwy			No change				
109	Brown Tourist Sign	-37.7165865	140.50095783333300	Intersection Sign	Tantanoola Caves	At Location	Princes Hwy			No change				
110	Brown Tourist Sign	-37.713319	140.49897866666700	Advance Warning Sign	Tantanoola	Southbound	Princes Hwy			No change				
111	Brown Tourist Sign	-37.71919284143500	140.50260906890000	Advance Warning Sign	Tantanoola Caves	Northbound	Princes Hwy			No change				
112	Various Signs	-37.71922802530900	140.50250682481600	Trail Marker	Southern Ocean Drive	Northbound	Princes Hwy			No change				
113	Brown Tourist Sign	-37.72477517839310	140.5061463733580	Intersection Sign	Windfarm Tourist Dr	Intersection of	Princes Hwy	& Tantanoola Rd		No change				

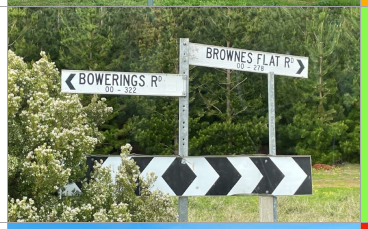
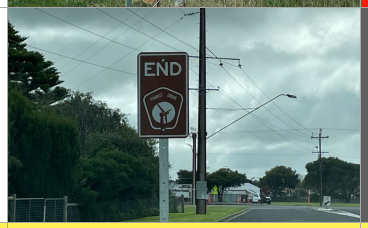
114	Green Directional Sign	-37.724718067618900	140.5062085404360	Intersection Sign	Mt Gambier	Intersection of	Princes Hwy	& Tantanoola Rd		No change				
115	Green Directional Sign	-37.723961763602800	140.503738125483	Advance Warning Sign	Mt Gambier	Eastbound	Tantanoola Rd			No change				
116	Green Directional Sign	-37.72635696619760	140.50906215153900	Advance Warning Sign	Millicent	Northbound	Princes Hwy			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 of Strategy			High Priority, Ongoing
117	Brown Tourist Sign	-37.72601130503840	140.50838502335100	Advance Warning Sign	Tantanoola Caves	Northbound	Princes Hwy			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 23 of WRC Strategy			High Priority, Ongoing
118	Green Directional Sign	-37.742092666666700	140.5838805	Advance Warning Sign	Mt Gambier	Southbound	Princes Hwy			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 of Strategy			High Priority, Ongoing
119	Green Directional Sign	-37.74244056770910	140.58761661348100	Intersection Sign	Glencoe	Intersection of	Princes Hwy	& The Sorings Rd		Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 & 42 of WRC Strategy			High Priority, Ongoing

120	Green Directional Sign	-37.680999166666700	140.47907950000000	Advance Warning Sign	Millicent	Northbound	Princes Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel			Low Priority, Year 3
121	Green Directional Sign	-37.68420081589170	140.48589083379200	Intersection Sign	Glencoe	Intersection of	Princes Hwy	& Glencoe		Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 & 42 of WRC Strategy			High Priority, Ongoing
122	Green Directional Sign	-37.74321916666670	140.59143	Advance Warning Sign	Millicent	Northbound	Princes Hwy			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 of Strategy			High Priority, Ongoing
123	Various Signs	-37.74744333333330	140.609421	Entry Statement Sign	Wattle Range Council	Northbound	Princes Hwy			Attention needed	Clean all boundary entry statements Anually			High Priority, Ongoing
124	Interpretive Sign	-37.75512688796760	140.5461141375270	Interpretive Sign	Pines Cave	At Location	Princes Hwy			No change				
125	Parks & Reserves Sign	-37.73167231123680	140.53017343407500	Regulatory Sign	Fossil Cave	Northbound	Princes Hwy			New Sign	• Develop interpretation for this significant Cave site			Low Priority, Year 3
	Princes Hwy (Southbound)													
	Tantanoola/ Windfarm Tourist													

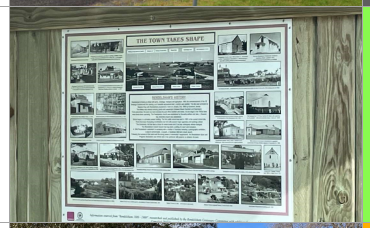
126	Various Signs	-37.713244333333300	140.46865916666700		Tasting room	At Location	Tantanoola Rd			Replace sign panel	• Install blue directional sign - Tasting Room with directional arrow. • Refer to page 43 of WRC Strategy			High Priority, Year 1
127	Brown Tourist Sign	-37.6993355	140.45727400000000	Intersection Sign	Windfarm	Northbound	Poonada Rd			New Sign	• Consolidate all signage at this location. • Install Blue fingerboards for Post Office, Public Toilets and Primary School under Brown intersection sign. • Install Millicent green fingerboard above Brown intersection sign.			Medium Priority, Year 2
128	Brown Tourist Sign	-37.69884003455310	140.457808575516	Intersection Sign	Windfarm Tourist Drive	Intersection of	Poonada Rd	& Railway Tce		No change				
129	Green Directional Sign	-37.69877347770510	140.45761711954400	Directional Sign	Millicent	Northbound	Railway Terrace E			Replace sign panel	• Panel faded and damaged • Replace sign panel			
130	Brown Tourist Sign	-37.734117102844400	140.40705735808300	Intersection Sign	Tourist Drive	Intersection of	Poonada Rd	& Cabinda Frontage Rd		Replace sign panel	• Replace sign posts. • Consolidate all signage at this location. • Road name sign positioned to top of stack. • Replace black Tasting Room sign with a blue fingerboard. • Install full length green fingerboard at bottom of stack.			High Priority, Year 1
	Brown Tourist Sign			Trailhead Sign	Tourist Drive		Cabinda Frontage Rd			New Sign	Install Windfarm Tourist Dr Trailhead sign			High Priority, Year 1

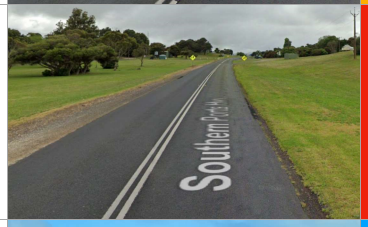
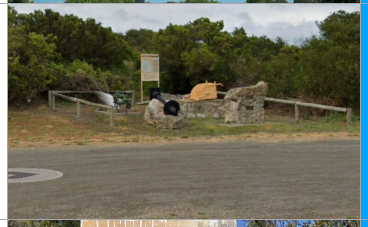
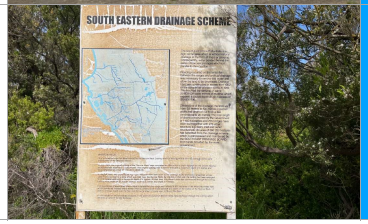
131	Various Signs	-37.718130333333300	140.43738133333300	Fingerboard Sign	Tasting Room	Westbound	Poonada Rd			Replace sign panel	• Replace black Tasting Room sign with a blue fingerboard.			High Priority, Year 1
132	Brown Tourist Sign	-37.69997283333330	140.45607866666700	Trail Marker	End	Eastbound	Poonada Rd			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads. • Refer to page 22 of Strategy			High Priority, Ongoing
133	Various Signs	-37.696450715919700	140.45595662681400	Tourist Information	Designated camping	Northbound	Tantanoola Rd			New Sign	Install double sided RV Dump Point sign at this location			High Priority, Year 1
134	Brown Tourist Sign	-37.69671653296140	140.45618588306700	Fingerboard Sign	Various	Northbound	Tantanoola Rd			No change				
135	Interpretive Sign	-37.69681280568680	140.45608701684500	Interpretive Sign	Memorial	Northbound	Tantanoola Rd			No change				
136	Brown Tourist Sign	-37.69368110089710	140.45425290369800	Intersection Sign	Tantanoola Tiger	Southbound	Tantanoola Rd			Replace sign panel	• Consolidate signage at this location. • Replace faded Brown intersection sign. • Install blue positional sign panel underneath with toilets, RV Dump Point symbols.			Medium Priority, Year 2

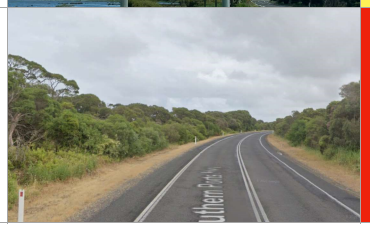
137	Green Directional Sign	-37.67020016666670	140.4324315	Advance Warning Sign	Mt Gambier	Northbound	Tantanoola Rd			No change				
138	Brown Tourist Sign	-37.641867427190400	140.30326366437600	Intersection Sign	Tourist Drive	Intersection of	Canunda Frontage Rd	& Lossie Rd		Replace sign panel	• High pressure clean lichen infested road signage • Replace black Tasting Room sign with a blue fingerboard. • Install brown intersection sign for Canunda NP. • Install brown intersection sign for Lake Bonney.			High Priority, Year 1
139	Brown Tourist Sign	-37.64105388923490	140.30230324227500	Fingerboard Sign	Canunda NP	Intersection of	Canunda Frontage Rd	& Canunda Causeway		Replace sign panel	• Install large brown intersection sign for Canunda NP			High Priority, Year 1
140	Various Signs	-37.63397033333330	140.29636133333300	Directional Sign	Tasting Room	Northbound	Canunda Frontage Rd			Replace sign panel	• Repair sign poles • Replace black Tasting Room sign with a blue directional sign.			High Priority, Year 1
141	Green Directional Sign	-37.642855833333300	140.30437766666700	Intersection Sign	Millicent	Intersection of	Canunda Frontage Rd	Lossie Rd		Replace sign panel	• High pressure clean lichen infested road signage • Replace black Tasting Room sign with a blue directional sign.			High Priority, Year 1
142	Various Signs	-37.66776316666670	140.32654283333300	Fingerboard Sign	Lake Bonney Rd	Intersection of	Canunda Frontage Rd	& Lake Bonney Rd		New Sign	Install brown fingerboard sign "Lake Bonney" and distance.			High Priority, Year 1

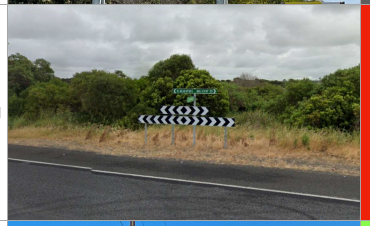
143	Brown Tourist Sign	-37.67732016666670	140.31046550000000	Trail Marker	None	Southbound	Canunda Frontage Rd			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads.			High Priority, Ongoing
144	Brown Tourist Sign	-37.67176716666670	140.3304775	Trail Marker	None	Northbound	Canunda Frontage Rd			Attention needed	• High pressure clean lichen infested road signage on WRC controlled roads.			High Priority, Ongoing
145	Various Signs	-37.73561332035130	140.38002405699300	Fingerboard Sign	Tasting Room	Northbound	Canunda Frontage Rd			Replace sign panel	• Replace black Tasting Room sign with a blue fingerboard.			High Priority, Year 1
146	Various Signs	-37.82848128121140	140.44666855609100	Fingerboard Sign	Brown's Flat Road	Northbound	Poonada Rd			No change				
147	Various Signs	-37.71956620954050	140.36948377775700	Fingerboard Sign	Lake Bonney Access Rd	Intersection of	Canunda Frontage Rd	Lake Bonney Access Rd		New Sign	• Install brown fingerboard sign "Lake Bonney" and distance.			High Priority, Year 1
148	Brown Tourist Sign	-37.59689766666670	140.34337883333300	Trailhead Sign	End	Eastbound	Lossie Rd			Remove sign	Wrong location Refer to page 28 of WRC Strategy. This sign replaced by sign 45B			High Priority, Year 2
	Tantanoola/ Windfarm Tourist													
	Southern Ports Hwy (North Bound)													

149	Green Directional Sign	-37.58439572177060	140.3172082998560	Reassurance Sign	Southend 23	Northbound	Southern Ports Hwy			Replace sign panel	Sign panel faded Refer to page 22 of WRC Strategy			Low Priority, Year 3
150	Various Signs	-37.58439778444750	140.31721610862500	Trail Marker	Southern Ocean Drive	Northbound	Southern Ports Hwy			No change				
151	Brown Tourist Sign	-37.58405390491880	140.31652430119600	Advance Warning Sign	Lake McIntyre	Southbound	Southern Ports Hwy			Attention needed	• Cut back trees			High Priority, Ongoing
152	Brown Tourist Sign	-37.582200328388800	140.30844014969600	Advance Warning Sign	Lake McIntyre 1km	Southbound	Southern Ports Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel			High Priority, Year 1
153	Blue Services Sign	-37.58131800976170	140.30220226875500	Advance Warning Sign	Millicent 5	Southbound	Southern Ports Hwy			No change				
154	Blue Services Sign	-37.56340516666670	140.248712	Fingerboard Sign	Nootka Yo-Long	Intersection of	Southern Ports Hwy	& Fosters Rd		No change				

155	Various Signs	-37.54954373163420	140.22798613665300	Entry Statement Sign	Rendelsham	Southbound	Southern Ports Hwy			New Sign				Medium Priority, Year 2
156	Blue Services Sign			Advance Warning Sign	Rest Stop Visitor Information Toilets 300m	Northbound	Southern Ports Hwy			New Sign	New Blue Service advance warning sign. • Rest Stop Icon • Toilet Icon • Visitor "I" icon • Standardise all visitor information bay road signage			Medium Priority, Year 2
157	Blue Services Sign			Positional Sign	Rest Stop Visitor Information Toilets 300m	At Location	Southern Ports Hwy			Replace sign panel	New Blue Service Sign. • Rest Stop Icon • Toilet Icon • Visitor "I" icon • Standardise all visitor information bay road signage			Medium Priority, Year 2
158	Blue Services Sign			Positional Sign	Toilets	At Location	Southern Ports Hwy			Remove sign	Sign replaced by signs 57 & 61			Medium Priority, Year 2
159	Interpretive Sign	-37.549708333333300	140.22611216666700	Interpretive Sign	The Town Takes Shape	At Location	Southern Ports Hwy			No change				
160	Various Signs	-37.54980691675840	140.22626478816100	Tourist Information	Welcome to Rendelsham	At Location	Southern Ports Hwy			Replace sign panel	• Standardise all visitor information bay signage • Refer to page 69 of WRC Strategy			Medium Priority, Year 2

161	Blue Services Sign			Positional Sign	Rest Stop Visitor Information Toilets 300m	At Location	Southern Ports Hwy			Replace sign panel	New Blue Service Sign. • Rest Stop Icon • Toilet Icon • Visitor "I" icon • Standardise all visitor information bay road signage		Medium Priority, Year 2
162	Blue Services Sign			Advance Warning Sign	Rest Stop Visitor Information Toilets 300m	Southbound	Southern Ports Hwy			New Sign	New Blue Service Sign. • Rest Stop Icon • Toilet Icon • Visitor "I" icon • Standardise all visitor information bay road signage		Medium Priority, Year 2
163	Brown Tourist Sign	-37.551375310903	140.20149369737200	Advance Warning Sign	Monument 400m	Northbound	Southern Ports Hwy			Refurbish or Remove	• Refurbish interpretation or remove all signage. • Refer to page 48 of WRC Strategy.			
164	Brown Tourist Sign	-37.551295598867200	140.1960750631400	Directional Sign	Monument	Northbound	Southern Ports Hwy			Refurbish or Remove	• Refurbish interpretation or remove all signage. • Refer to page 48 of WRC Strategy.			
165	Interpretive Sign	-37.55142468042860	140.19593784070000	Interpretive Sign	Monument	At Location	Southern Ports Hwy			Refurbish or Remove	• Refurbish interpretation or remove all signage. • Refer to page 48 of WRC Strategy.			
166	Interpretive Sign				South Eastern Drainage Scheme	At Location	Southern Ports Hwy			Refurbish or Remove	• Refurbish interpretation or remove all signage. • Refer to page 48 of WRC Strategy.			

167	Interpretive Sign	-37.55153966875070	140.1964790381730	Interpretive Sign	South Eastern Drainage Scheme	At Location	Southern Ports Hwy			Refurbish or Remove	• Refurbish interpretation or remove all signage. • Refer to page 48 of WRC Strategy.				
168	Various Signs				South Eastern Drainage Scheme	At Location	Southern Ports Hwy			Refurbish or Remove	• Refurbish interpretation or remove all signage. • Refer to page 48 of WRC Strategy.				
169	Brown Tourist Sign	-37.551375310903	140.20149369737200	Advance Warning Sign	Monument 400m	Southbound	Southern Ports Hwy			Refurbish or Remove	• Refurbish interpretation or remove all signage. • Refer to page 48 of WRC Strategy.				
170	Brown Tourist Sign	-37.53756272161070	140.16746299052500	Advance Warning Sign	Lake Frome Conservation park	Northbound	Southern Ports Hwy			Attention needed	• Cut back trees • Clean sign				High Priority, Ongoing
171	Brown Tourist Sign	-37.53700397627970	140.16421950742000	Intersection Sign	Lake Frome	Northbound	Southern Ports Hwy			Attention needed	• Clean Sign				High Priority, Ongoing
173	Blue Services Sign			Advance Warning Sign	Southend	Northbound	Southern Ports Hwy			New Sign	• Type - Blue Advance Warning Sign • Message - Southend Services • Symbol - Caravan, Fuel, Toilets, Boat Ramp Same as sign 173				High Priority, Year 1

172	Various Signs	-37.53692217161230	140.16357755691400	Entry Statement Sign	Welcome to Southend	Northbound	Southern Ports Hwy			Replace sign panel	• Reskin the existing Millicent , Beachport and Southend billboards. • Develop consistency between billboards as they become due for replacement			High Priority, Year 1
	Southern Ports Hwy (North														
	Southern Ports Hwy														
173	Green Directional Sign	-37.53395883333330	140.154179	Advance Warning Sign	Southend	Northbound	Southern Ports Hwy			No change				
174	Brown Tourist Sign	-37.5363545	140.15962066666700	Advance Warning Sign	Lake Frome	Southbound	Southern Ports Hwy			Attention needed	• Clean Sign			High Priority, Ongoing
175	Brown Tourist Sign	-37.53308214174460	140.1515437997280	Intersection Sign	Canunda NP	Intersection of	Southern Ports Hwy	& Southend Access Rd		Remove sign	• Move sign to other side of intersection			
175A	Brown Tourist Sign	-37.53308214174460	140.1515437997280	Intersection Sign	Canunda NP	Intersection of	Southern Ports Hwy	& Southend Access Rd		New Sign	• Relocate sign 175 Canunda NP to Intersection "T"			High Priority, Year 1
176	Blue Services Sign	-37.56629016666670	140.13632883333300	Tourist Information	RV Friendly Town	Westbound	Southend Access Rd			No change				

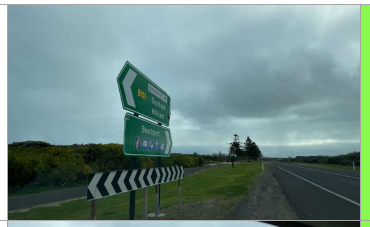
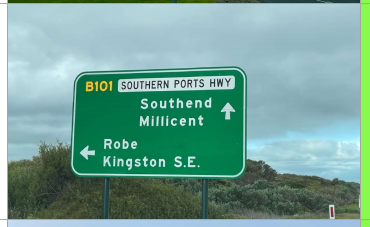
177	Various Signs	-37.56662783333330	140.13542133333300	Entry Statement Sign	Welcome to Southend	Westbound	Southend Access Rd			Remove sign	• Refer to page 67 of WRC Strategy				
178	Blue Services Sign	-37.56681316666670	140.13487866666700	Directional Sign	Visitor Information	Westbound	Southend Access Rd			Replace sign panel	• Replace with standard visitor information Bay signage. • Refer to page 69 of WRC Strategy				Medium Priority, Year 2
179	Various Signs	-37.56703265125440	140.13441199697100	Tourist Information	Welcome to Southend	Westbound	Southend Access Rd			Replace sign panel	• Standardise all visitor information bay signage • Refer to page 69 of WRC Strategy				Medium Priority, Year 2
180	Brown Tourist Sign	-37.56722236311620	140.13385372313500	Entry Statement Sign	Welcome to Southend	Westbound	Southend Access Rd/Eliza St			No change					
	Blue Services Sign	-37.569338391102700	140.12791418501700	Advance Warning Sign	Caravan park	Westbound	Southend Access Rd			New Sign	• Blue Advance Warning Sign with Caravan Symbol				High Priority, Year 1
181	Blue Services Sign	-37.569338391102700	140.12791418501700	Directional Sign	Caravan park	Intersection of	Eliza St	& Leake St		New Sign	• Consolidate signage at this location. • Replace with blue directional sign with caravan symbol and blue sailing club fingerboard.				High Priority, Year 1

182	Brown Tourist Sign	-37.56933446315150	140.12791151137400	Fingerboard Sign	Sailing Club	Intersection of	Eliza St	& Leake St		Remove sign	• Sign in wrong location • Replaced by new sign181 • Refer to page 55 WRC Strategy			High Priority, Year 1
183	Blue Services Sign	-37.56929892118790	140.12766832498800	Directional Sign	Southend Sands Caravan Park	Intersection of	Eliza St	& Leake St		Remove sign	• Remove - non-standard sign and symbols. • Wrong side of the road past the decision making point. • Replaced by new sign 181			High Priority, Year 1
184	Various Signs	-37.570452360859100	140.12312852749700	Directional Sign	Connie's Walk	Westbound	Cape Buffon Dr			Replace sign panel	• Type - Brown Trailhead Sign. • Message - Connie's Walk • Symbol - Hiking			Medium Priority, Year 2
185	Brown Tourist Sign	-37.57029183051580	140.1216278936770	Intersection Sign	Rivoli Bay Lookout	Westbound	Cape Buffon Dr			Replace sign panel	• Type - Brown Trailhead Sign. • Message - Cape Buffon Drive • Symbol - Hiking, Monument Lookout • Refer to page 14, 15 & 39 of WRC Strategy			Medium Priority, Year 2
186	Various Signs	-37.57131477544390	140.12148249254700	Directional Sign	Canunda NP	Intersection of	Cape Buffon Dr	& Boozy Gully Rd		Remove sign	• Remove - drive trail shield sign at this location.			Medium Priority, Year 2
187	Blue Services Sign	-37.574461086768500	140.13001704174200	Advance Warning Sign	Visitor Information	At Location	Cape Buffon Dr			Attention needed	• Clean sign • Standardise all visitor information bay road signage			High Priority, Ongoing

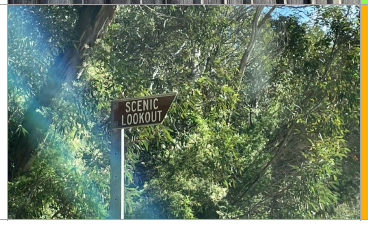
188	Brown Tourist Sign	-37.57560806352420	140.12980881160100	Trail Marker	Tourist Drive	Southbound	Cape Buffon Dr			Remove sign	• Remove - no drive trail at this location.			Medium Priority, Year 2
188A	Blue Services Sign	-37.57113559914910	140.11583309303900	Intersection Sign	RV Dump Point	Southbound	Cape Buffon Dr			New Sign	• Install Blue Directional Sign (double sided) • Symbol - RV Dump Point			High Priority, Year 1
189	Brown Tourist Sign	-37.57113559914910	140.11583309303900	Advance Warning Sign	Monument	Westbound	Cape Buffon Dr			No change				
190	Brown Tourist Sign	-37.570743529188200	140.11546782754100	Fingerboard Sign	Monument	Westbound	Cape Buffon Dr			Replace sign panel	• Install Brown Positional Sign (double sided) • Message - Geltridge Memorial • Symbol - Monument Refer to page 39 of WRC Strategy			Medium Priority, Year 2
191	Interpretive Sign	-37.57066098045350	140.11551238609500	Interpretive Sign	Geltwood Anchor Memorial	Eastbound	Cape Buffon Dr			Attention needed	Interpretive panels have been produced on white colour bond sheet metal - this material is not suitable for coastal environments. Anti grafitti laminate has been poorly applied and delaminating from the sign surface Refer to page 39, 40 & 75 of WRC Strategy			Low Priority, Year 3
192	Brown Tourist Sign			Fingerboard Sign	Cape Buffon Walking Trail	Westbound	Cape Buffon Dr			New Sign	• Install Brown Fingerboard sign (double sided) • Message - Cape Buffon Walk • Symbol - Hiking symbol Refer to page 39 of WRC Strategy			Medium Priority, Year 2

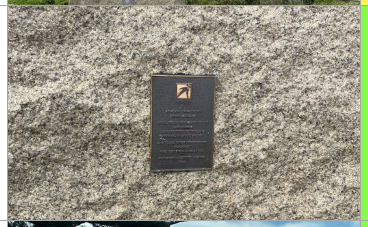
193	Brown Tourist Sign	-37.57124243502070	140.1127148220790	Directional Sign	Cape Buffon Walking Trail	Westbound	Cape Buffon Dr			New Sign	• Install Brown Trailhead sign • Message - Cape Buffon Walk • Symbol - Hiking symbol Refer to page 39 of WRC Strategy			Medium Priority, Year 2
194	Brown Tourist Sign	-37.56795592695120	140.11228766649800	Trail Marker	Tourist Drive	Westbound	Cape Buffon Dr			Remove sign	• Remove - no drive trail at this location.			Medium Priority, Year 2
195	Brown Tourist Sign			Fingerboard Sign	Cape Buffon Walking Trail	Westbound	Cape Buffon Dr			New Sign	• Install Brown Positional sign (double sided) • Message - Cape Buffon Walk, Jetty Lookout • Symbol - Hiking and Lookout symbol Refer to page 39 of WRC Strategy			Medium Priority, Year 2
196	Brown Tourist Sign	-37.56692126987380	140.11275507830000	Trailhead Sign	Cape Buffon Walking Trail	Westbound	Cape Buffon Dr			New Sign	• Install Brown Trailhead sign • Message - Cape Buffon Walk • Symbol - Hiking symbol Refer to page 39 of WRC Strategy			Medium Priority, Year 2
197	Interpretive Sign	-37.56613201084880	140.10815950010800	Interpretive Sign	Canunda NP	At Location	Cape Buffon Dr			No change				
198	Brown Tourist Sign	-37.566259559278900	140.1085783728770	Trail Marker	Trail icon	Westbound	Cape Buffon Dr			New Sign	• Install Brown Trailhead sign • Message - Cape Buffon Walk • Symbol - Hiking symbol Refer to page 39 of WRC Strategy			Medium Priority, Year 2
	Southern Ports Hwy													
	Southern Ports Hwy (North													

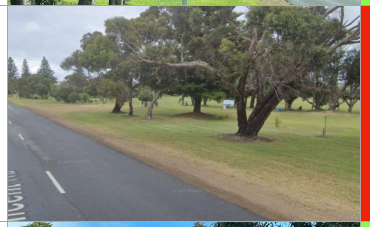
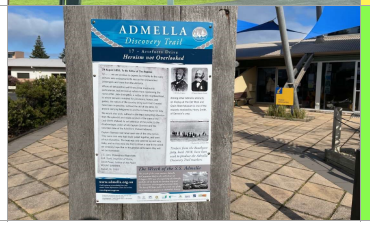
199	Green Directional Sign	-37.53304283333330	140.15135466666700	Intersection Sign	Beachport-Millicent	Intersection of	Southern Ports Hwy	& Southend Rd		No change					
200	Various Signs	-37.53692217161230	140.16357755691400	Entry Statement Sign	Welcome to Southend	Southbound	Southern Ports Hwy			New Sign	• Install Promotional Billboard • Message - Southend • Symbol - None				High Priority, Year 1
173	Blue Services Sign			Advance Warning Sign	Southend	Southbound	Southern Ports Hwy			New Sign	• Install Blue Advance Warning Sign • Message - Southend Services • Symbol - Caravan, Fuel, Toilets, Boat Ramp Same as sign 173				High Priority, Year 1
201	Green Directional Sign	-37.47449733333330	140.04119116666700	Reassurance Sign	Southend 17	Southbound	Southern Ports Hwy			No change					
202	Green Directional Sign	-37.47443666666670	140.04005600000000	Advance Warning Sign	Beachport	Northbound	Southern Ports Hwy			No change					
203	Various Signs	-37.47424350000000	140.03843900000000	Entry Statement Sign	Welcome to Beachport	Northbound	Southern Ports Hwy			Replace sign panel	• Reskin the existing Millicent , Beachport and Southend billboards. • Develop consistency between billboards as they become due for replacement				High Priority, Year 1

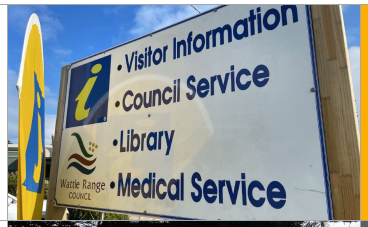
204	Green Directional Sign	-37.47406	140.03698533333300	Intersection Sign	Southend	Intersection of	Southern Ports Hwy	& Southern Ports Hwy		No change					
205	Green Directional Sign	-37.473854	140.03684133333300	Intersection Sign	Robe	Northbound	Southern Ports Hwy			No change					
206	Various Signs	-37.47355781484360	140.03695067887700	Entry Statement Sign	Welcome to Beachport	Southbound	Southern Ports Hwy			Replace sign panel	• Reskin the existing Millicent , Beachport and Southend billboards. • Develop consistency between billboards as they become due for replacement				High Priority, Year 1
207	Brown Tourist Sign	-37.473981333333300	140.03636166666700	Advance Warning Sign	Surf Beach 450mts	Northbound	Millicent Rd			No change					
208	Green Directional Sign	-37.473566166666700	140.03395683333300	Advance Warning Sign	Southend	Southbound	Southern Ports Hwy			No change					
209	Green Directional Sign	-37.4704395	140.03921233333300	Reassurance Sign	Robe 47	Northbound	Southern Ports Hwy			No change					

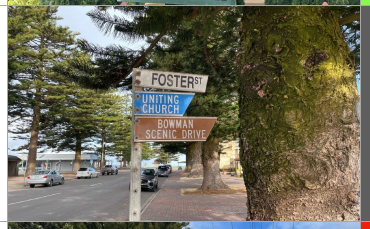
210	Green Directional Sign	-37.470025666666700	140.03970816666700	Advance Warning Sign	Beachport	Southbound	Southern Ports Hwy			Attention needed	Cut back trees			High Priority, Ongoing
211	Blue Services Sign	-37.45334833333330	140.04311466666700	Advance Warning Sign	Beachport 5	Southbound	Southern Ports Hwy			Replace sign panel	• Panel faded and damaged • Replace sign panel			Medium Priority, Year 2
212	Green Directional Sign	-37.451045166666700	140.04187033333300	Advance Warning Sign	Penola	Northbound	Southern Ports Hwy			No change				
213	Green Directional Sign	-37.44804079343280	140.0436272388900	Intersection Sign	Robe	Intersection of	Southern Ports Hwy	& Beachport-Penola Rd		Replace sign panel	• Panel faded and damaged • Replace sign panel			Low Priority, Year 3
214	Green Directional Sign	-37.44304733333330	140.04299333333300	Advance Warning Sign	Beachport	Southbound	Southern Ports Hwy			No change				
215	Brown Tourist Sign	-37.39468183333330	140.0299805	Advance Warning Sign	Lookout	Northbound	Southern Ports Hwy			Attention needed	• Cut back trees			High Priority, Ongoing

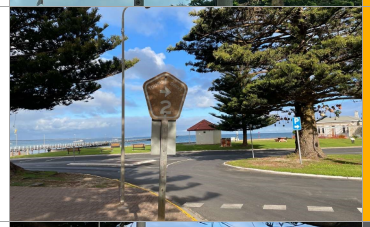
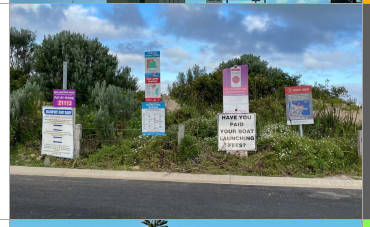
216	Brown Tourist Sign	-37.38867366666670	140.0250265	Advance Warning Sign	Lookout 400m	Southbound	Southern Ports Hwy			No change				
217	Brown Tourist Sign	-37.3917465	140.0273565	Intersection Sign	Woakwine Cutting	Intersection of	Southern Ports Hwy	& Woakwine Cutting Rd		No change				
218	Brown Tourist Sign	-37.38784165590760	140.03602185299600	Intersection Sign	Woakwine Cutting	Eastbound	Woakwine Cutting Rd			Replace sign panel	• Type - Brown Positional Sign • Message - Woakwine Cutting • Symbol - Lookout			Medium Priority, Year 2
219	Brown Tourist Sign	-37.38788436739680	140.03607174089900	Fingerboard Sign	Lookout 500m	Eastbound	Woakwine Cutting Rd			Replace sign panel	• Type - Brown Positional Sign • Message - Lookout • Symbol - Lookout			Medium Priority, Year 2
220	Interpretive Sign	-37.38810847190650	140.03583168271800	Interpretive Sign	Woakwine Cutting	At Location	Woakwine Cutting Rd			No change				
221	Brown Tourist Sign	-37.38499097063890	140.0398813841310	Fingerboard Sign	Scenic lookout	Eastbound	Woakwine Cutting Rd			Replace sign panel	• Replace with standard brown intersection sign with Lookout symbol.			Medium Priority, Year 2

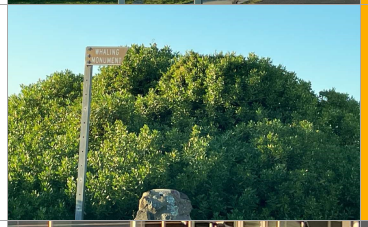
222	Various Signs	-37.321338	139.955532	Entry Statement Sign	Wattle Range Council -Welcome	Southbound	Southern Ports Hwy			Attention needed	Clean all boundary entry statements Anually			High Priority, Ongoing
	Southern Ports Hwy (North													
	Beachport/ Bowman													
223	Brown Tourist Sign	-37.4736855	140.03123683333300	Directional Sign	WW2 Mine Explosion Memorial	Westbound	Millicent Rd			No change				
224	Brown Tourist Sign	-37.47398538857510	140.0316105877670	Fingerboard Sign	Monument	At Location	Millicent Rd			Attention needed	Straighten Post			High Priority, Ongoing
225	Interpretive Sign	-37.47385728235810	140.03164780474400	Interpretive Sign	Memorial	At Location	Millicent Rd			No change				
226	Brown Tourist Sign	-37.47482266666670	140.02439566666700	Advance Warning Sign	Beachport Attractions	Westbound	Millicent Rd			No change				
227	Brown Tourist Sign	-37.47740016666670	140.01774700000000	Directional Sign	Bowman Scenic Dr	Westbound	Millicent Rd			Remove sign	• Bowman Scenic Drive does not start here			High Priority, Year 1

228	Blue Services Sign	-37.47740016666670	140.01774700000000	Advance Warning Sign	Various	Westbound	Millicent Rd			Replace sign panel	• Type - Blue Advance Warning Sign • Message - (Top) Beachport CP 250m, (Bottom) Southern Ocean Tourist Park 1.2km • Symbol - Caravan			High Priority, Year 1
229	Blue Services Sign	-37.47826566666670	140.01614783333300	Advance Warning Sign	Visitor Center 300m	Westbound	Millicent Rd			No change				
229A	Blue Services Sign			Intersection Sign	Caravan Park	Westbound	Millicent Rd			New Sign	• Type - Blue Directional Sign • Message - Arrow (Left) • Symbol - Caravan			High Priority, Year 1
230	Blue Services Sign	-37.479877493093900	140.01343790782100	Directional Sign	Visitor Center	At Location	Millicent Rd			No change				
231	Blue Services Sign	-37.480069	140.01325	Directional Sign	RVDump	At Location	Millicent Rd			Attention needed	• Relocate RV Dump Point to a new location away from VC.			Medium Priority, Year 2
232	Interpretive Sign	-37.47561428610950	140.0154472142460	Interpretive Sign	Admella Discovery Trail	At Location	Millicent Rd			No change	Refer to page 74 of WRC Strategy			

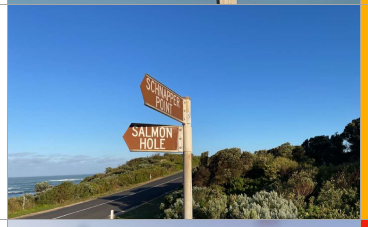
234	Various Signs	-37.4800848677749	140.01340411129200	Tourist Information	Visitor Information	At Location	Millicent Rd			Replace sign panel	• Type - Blue Facility Sign • Message - Beachport VC, Other Services • Symbol - Yellow "i"			Medium Priority, Year 2
235	Blue Services Sign	-37.48046238677390	140.01272862448500	Directional Sign	Caravan park	Westbound	Millicent Rd			Remove sign	• Redundant Sign			
236	Brown Tourist Sign	-37.48050410751000	140.01254637117400	Intersection Sign	Bowman Scenic Dr	Intersection of	Millicent Rd	& Railway Tce		New Sign	• Replace with consolidated sign example on Page 20			High Priority, Year 1
237	Blue Services Sign	-37.48060510031660	140.0124296454150	Intersection Sign	Police	Intersection of	Millicent Rd	& Railway Tce		Remove sign	• Consolidate with signs at 236			High Priority, Year 1
238	Brown Tourist Sign	-37.48060825947950	140.0126668965430	Fingerboard Sign	Old Customs House	Southbound	Railway Tce			Replace sign panel	• Type - Brown Fingerboard Sign • Message - Old Customs House • Symbol - Historic Refer to page 26 of WRC Strategy			High Priority, Year 1
239	Brown Tourist Sign	-37.48083557495390	140.0128531469950	Trailhead Sign	Start Finish Beachport Tourist Drive	Southbound	Railway Tce			Replace sign panel	• Replace Brown Trailhead Sign • Message - Bowman Scenic Dr • Symbol - Tourist Dr 2 • Install Blue Positional Sign • Message - Caravan Park • Symbol - Caravan, Arrow Refer to page 26 of WRC Strategy			High Priority, Year 1

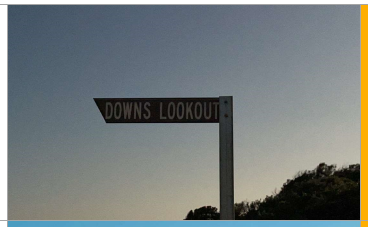
240	Blue Services Sign	-37.480825919454200	140.01285003592500	Directional Sign	Caravan park	Intersection of	Railway Tce	Lanky St		Remove sign	• This sign replaced by new sign at Sign 239 Refer to page 54 of WRC Strategy			High Priority, Year 1
240A	Blue Services Sign	-37.481716736868600	140.01196198444500	Directional Sign	Caravan park	Intersection of	Lanky St	& Chambers		New Sign	• Type - Blue Directional Sign • Message - Arrow (Left) • Symbol - Caravan			High Priority, Year 1
241	Blue Services Sign	-37.481716736868600	140.01196198444500	Directional Sign	Caravan park	Intersection of	Lanky St	& Chambers		Remove sign	• Wrong location, past decision making point (Replaced by new sign at 240A)			High Priority, Year 1
242	Various Signs	-37.48103110227800	140.01274870273800	Tourist Information	Beachport Guide	Intersection of	Railway Tce	& Lanky St		No change				
243	Brown Tourist Sign	-37.481361776625300	140.01304504474600	Fingerboard Sign	Bowman Scenic Dr	Intersection of	Railway Tce	& Foster St		Remove sign	• Not Bowman Scenic Drive Route			Low Priority, Year 3
244	Brown Tourist Sign	-37.481236065079200	140.0130282478570	Fingerboard Sign	Baytree Cottage Crafts	Intersection of	Railway Tce	& Foster St		New Sign	• Type - Blue Directional Sign • Message - Post Office			Low Priority, Year 3

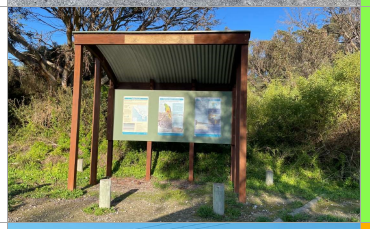
245	Blue Services Sign	-37.481725263987100	140.01396536625100	Directional Sign	Toilets	Southbound	Railway Tce			Replace sign panel	• Replace with Australian Standard universal access toilet sign. Refer to page 16 of WRC Strategy.			High Priority, Year 1
246	Brown Tourist Sign	-37.48197578979400	140.01430774616100	Trail Marker	Tourist Drive 2	Intersection of	Railway Tce	& Beach Rd		Replace sign panel	• Replace Brown Trail Marker • Message - Tourist Dr 2, Right Arrow • Symbol - Tourist Dr Marker Refer to page 26 of WRC Strategy.			High Priority, Year 1
247	Blue Services Sign	-37.482102192041900	140.01434348536700	Directional Sign	Caravan park & B&B	Intersection of	Railway Tce	& Beach Rd		Remove sign	• Past turn-off to Caravan Park at Lanky St.			High Priority, Year 1
248	Brown Tourist Sign	-37.48344318487790	140.01435687063300	Reassurance Sign	Bowman Scenic Dr	Intersection of	Beach Rd	& Corigliano St		Replace sign panel	• Replace existing sign with Brown Trail Marker • Message - Tourist Dr 2 Refer to page 26 of WRC Strategy.			High Priority, Year 1
249	Various Signs	-37.48479891235660	140.0148108412900	Regulatory Sign	Various	ion - Beachport Bo	Beach Rd			Remove sign	Refer to page 20 of WRC Strategy			Medium Priority, Year 2
250	Blue Services Sign	-37.48374833333330	140.0143843333330	Directional Sign	Toilets	Southbound	Beach Rd			No change				

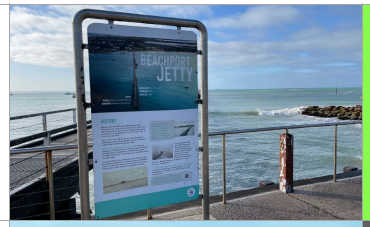
251	Blue Services Sign	-37.48444833333330	140.01438533333300	Directional Sign	Caravan park	Intersection of	Beach Rd	& Blacketer St		Remove sign	• Past turn-off to Caravan Park at Lanky St.			Medium Priority, Year 2
252	Brown Tourist Sign	-37.48721762297810	140.01436782835800	Intersection Sign	Bowman Scenic Dr	Intersection of	Beach Rd	& South Tce		Replace sign panel	• Panel faded and damaged • Brown Trail Marker • Message - Tourist Dr 2, right arrow Refer to page 26 of WRC Strategy.			High Priority, Year 1
253	Interpretive Sign	-37.4875640094789	140.0143690478770	Interpretive Sign	Whaling Monument	Southbound	Beach Rd			Replace sign panel	• Panel faded and damaged • Type - Brown Fingerboard • Message - Whaling Monument • Symbol - Monument Refer to page 26 of WRC Strategy.			High Priority, Year 1
254	Brown Tourist Sign	-37.487407332494100	140.0143684962560	Fingerboard Sign	Bowman Scenic Dr	Intersection of	Beach Rd	& South Tce		Remove sign	• Sign too small, past the decision making point Refer to page 25 of WRC Strategy			High Priority, Year 1
	Brown Tourist Sign			Trail Marker	Bowman Scenic Dr	Northbound	South Tce			New Sign	• Type - Brown Trail Marker • Message - Tourist Dr 2, Left Arrow Refer to page 26 of WRC Strategy.			High Priority, Year 1
255	Brown Tourist Sign	-37.487600327562600	140.0133431666670	Intersection Sign	Bowman Scenic Dr	Intersection of	South Tce	& Foster St		Remove sign	• Past the decision making point Refer to page 25 of WRC Strategy			High Priority, Year 1

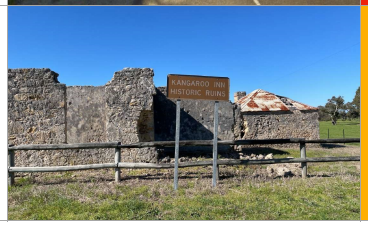
256	Brown Tourist Sign	-37.48833633730490	140.0131471510800	Trail Marker	Tourist Drive 2	Southbound	Foster St			Replace sign panel	• Panel faded and damaged • Replace Brown Trail Marker • Message - Tourist Dr 2, Right Arrow Refer to page 25 of WRC Strategy			High Priority, Year 1
257	Brown Tourist Sign	-37.48862702476940	140.0131484784240	Intersection Sign	Bowman Scenic Dr	Intersection of	Foster St	& McCarhur Pl		Replace sign panel	• Panel faded and damaged • Replace Brown Trail Marker • Message - Tourist Dr 2, Right Arrow Refer to page 25 of WRC Strategy			High Priority, Year 1
258	Blue Services Sign	-37.48909786002100	140.01313950657200	Directional Sign	Cape Martin Lighthouse Walkway	At Location	Foster St			Replace sign panel	• Panel faded and damaged • Install Brown Positional Sign • Message - Cape Martin Lighthouse • Symbols - Hiking, Lookout Refer to page 34 of WRC Strategy			High Priority, Year 1
259	Brown Tourist Sign	-37.48882767633550	140.01264836658000	Trail Marker	Tourist Drive 2	Intersection of	Foster St	& McArthur Place		Replace sign panel	• Panel faded and damaged • Replace Brown Trail Marker • Message - Tourist Dr 2, Right Arrow Refer to page 25 of WRC Strategy			High Priority, Year 1
260	Brown Tourist Sign	-37.48882767633530	140.01264836658000	Fingerboard Sign	Bowman Scenic Dr	Intersection of	McArthur Place	& McArthur Pl		Remove sign	• Redundant sign, location covered by sign 259 Refer to page 25 of WRC Strategy			High Priority, Year 1
261	Interpretive Sign	-37.487175386266900	140.00970719614100	Interpretive Sign	Southern Ocean	At Location	Scenic Dr			Replace sign panel	• Panel faded and damaged Refer to page 74 of WRC Strategy			Low Priority, Year 3

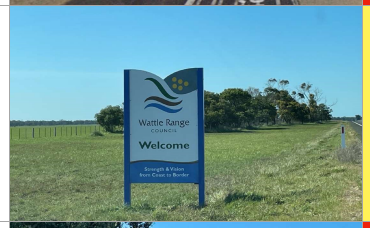
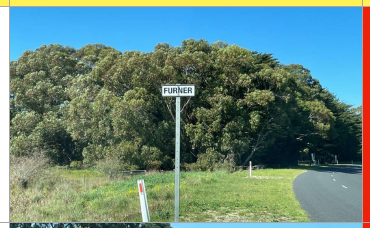
262	Brown Tourist Sign	-37.48710483937000	140.00978512110200	Fingerboard Sign	Backless Lookout	Northbound	Scenic Dr			Replace sign panel	• Panel faded and damaged • Replace Brown Fingerboard • Message - Backler's Lookout • Symbols - Lookout Refer to page 26 of WRC Strategy			High Priority, Year 1
263	Brown Tourist Sign	-37.48615000755160	140.00207087829800	Fingerboard Sign	Salmon Hole	Northbound	Scenic Dr			Replace sign panel	• Panel faded and damaged • Replace Brown Fingerboard • Message - Schnapper Point, Salmon Hole • Symbols - Lookout Refer to page 26 of WRC Strategy			High Priority, Year 1
263A	Brown Tourist Sign			Positional Sign	Pool of Siloam	Northbound	McCourt St			New Sign	• Install Brown Positional Sign • Message - Pool of Siloam • Symbols - Nil Refer to page 26 of WRC Strategy			High Priority, Year 1
264	Brown Tourist Sign	-37.48325633333330	140.001047	Fingerboard Sign	Pool of Siloam	Northbound	McCourt St			Replace sign panel	• Replace Brown Positional Sign • Message - Pool of Siloam • Symbols - Nil Refer to page 26 of WRC Strategy			High Priority, Year 1
265	Brown Tourist Sign	-37.48389707338890	140.00036492996500	Intersection Sign	Bowman Scenic Drive	Northbound	Scenic Dr			No change	This sign is confusing. Refer to page 25 of WRC Strategy			
266	Brown Tourist Sign	-37.48344106884800	139.99878571384900	Intersection Sign	Post office Rock	Northbound	Scenic Dr			Replace sign panel	• Panel faded and damaged • Replace Brown Positional Sign • Message - Post Office Rock • Symbols - Lookout Refer to page 26 of WRC Strategy			High Priority, Year 1

267	Brown Tourist Sign	-37.48170245907980	139.99861040165600	Fingerboard Sign	Downs Lookout	Northbound	Scenic Dr			Replace sign panel	• Panel faded and damaged • Replace Brown Fingerboard Sign • Message - Downs Lookout • Symbols - Lookout Refer to page 26 of WRC Strategy		High Priority, Year 1
268	Brown Tourist Sign	-37.47799091997740	139.99778315242700	Fingerboard Sign	Blowhole	Northbound	Scenic Dr			Replace sign panel	• Panel faded and damaged • Replace Brown Fingerboard Sign • Message - Blowholes • Symbols - Lookout Refer to page 26 of WRC Strategy		High Priority, Year 1
269	Brown Tourist Sign	-37.477578666666700	140.0016316666670	Trail Marker	Tourist Drive 2	Southbound	South West Tce			Replace sign panel	• Panel faded and damaged • Replace Brown Trail Marker • Message - Tourist Dr 2, Straight Arrow Refer to page 25 of WRC Strategy		High Priority, Year 1
270	Various Signs	-37.47938016666670	140.00399266666700	Fingerboard Sign	Lankys Well Nature Trail	Southbound	Parklands Tce			Replace sign panel	• Wrong sign type • Replace Brown Fingerboard • Message - Lanky's Well Nature Walk • Symbols - Hiking Refer to page 35 of WRC Strategy		High Priority, Year 1
271	Brown Tourist Sign	-37.476637027765400	140.00752558901800	Fingerboard Sign	Lake George	Intersection of	Parklands Tce	& Railway Tce		Replace sign panel	• Panel faded and damaged • Replace Brown Intersection Sign • Message - Beachport Conservation Park (Left). Tourist Dr 2 (Right Arrow) Refer to page 25 of WRC Strategy		High Priority, Year 1
	Brown Tourist Sign			Trail End Sign	Bowman Scenic Drive End	Westbound	Railway Tce			New Sign	• Install Bowman Scenic Dr Trail End Sign		High Priority, Year 1

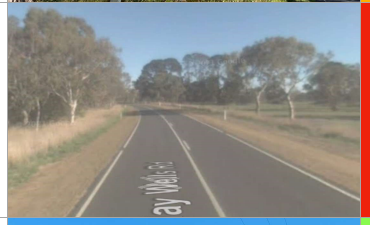
272	Various Signs	-37.465895959504000	139.99892462720000	Entry Statement Sign	Beachport Conservation Park	Northbound	Lake George Rd			No change				
272A	Brown Tourist Sign	-37.465895959504000	139.99892462720000	Fingerboard Sign	Lake George	Northbound	Lake George Rd			New Sign	• Install Brown Fingerboard • Message - None • Symbols - Monument Refer to page 34 of WRC Strategy			High Priority, Year 1
273	Interpretive Sign	-37.4659112770617	139.99909640402000	Interpretive Sign	Old Robe to Beachport Track	Northbound	Lake George Rd			No change				
274	Various Signs	-37.466331309220100	139.99888820744700	Tourist Information	Visitor Information Bay	Northbound	Lake George Rd			No change				
275	Green Directional Sign	-37.47705261570880	140.00835319477200	Intersection Sign	Robe	Southbound	Lake George Rd			Replace sign panel	• Replace Green Intersection Sign • Message - Millicent • Symbols - Nil Refer to page 22 of WRC Strategy			Low Priority, Year 3
276	Brown Tourist Sign	-37.477206427610600	140.00856218191200	Fingerboard Sign	Lankys Well Nature Walk	Intersection of	Lake George Rd	& Golf Course Rd		Replace sign panel	• Replace Brown Fingerboard • Message - Lanky's Well Nature Walk • Symbols - Hiking Refer to page 34 of WRC Strategy			High Priority, Year 1

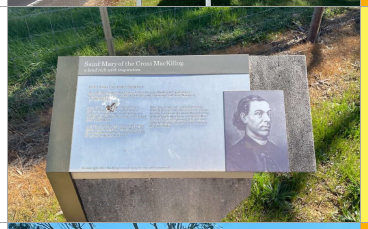
277	Interpretive Sign	-37.481839628925100	140.0150722080280	Interpretive Sign	Beachport Jetty	At Location	Beach Rd			No change				
278	Brown Tourist Sign	-37.4777499358228	140.01829093311500	Intersection Sign	Bowman Scenic Drive	Northbound	Beach Rd			Remove sign	• Bowman Scenic Drive does not start here			High Priority, Year 1
	Beachport/ Bowman													
	Beachport Penola Rd/Clay													
279	Green Directional Sign	-37.44604869283500	140.04666225997700	Advance Warning Sign	Beachport	Westbound	Beachport-Penola Rd			No change				
280	Blue Services Sign	-37.441699422169500	140.07599143688300	Directional Sign	Cyclists	Eastbound	Beachport-Penola Rd			Remove sign	• Remove redundant signage • Refer to page 24 of Strategy			Low Priority, Year 3
281	Blue Services Sign	-37.43139658018260	140.11532931938800	Directional Sign	Cyclists	Eastbound	Beachport-Penola Rd			Remove sign	• Remove redundant signage • Refer to page 24 of Strategy			Low Priority, Year 3
282	Green Directional Sign	-37.398952666666700	140.16703883333300	Intersection Sign	Millicent	Intersection of	Beachport-Penola Rd	& Beachport-Furner Rd		Replace sign panel	• Type - Green Intersection Sign • Message - Millicent • Symbols - Nil Refer to page 22 of WRC Strategy			Low Priority, Year 3

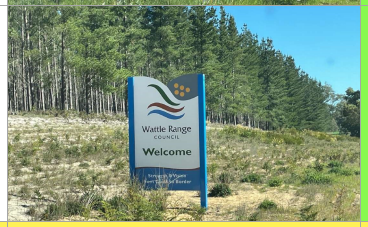
283	Green Directional Sign	-37.39790983333330	140.16885116666700	Advance Warning Sign	Beachport	Westbound	Beachport-Penola Rd			No change				
	Brown Tourist Sign			Advance Warning Sign	Kangaroo Inn Historic Ruins	Eastbound	Beachport-Penola Rd			New Sign	• Install Brown Advance Warning sign. • Message - Kangaroo In Ruins • Symbols - Historic Refer to page 45 of WRC Strategy and page 49/ diagram 2			High Priority, Year 1
284	Green Directional Sign	-37.3373151353295	140.24896033734900	Intersection Sign	Beachport	Intersection of	Beachport-Penola Rd	& Clay Wells Rd		No change				
285	Green Directional Sign			Intersection Sign	Beachport	Intersection of	Beachport-Penola Rd	& Clay Wells Rd		No change				
	Brown Tourist Sign			Intersection Sign	Kangaroo Inn Historic Ruins	Eastbound	Clay Wells Rd			New Sign	• Install Brown Positional sign (double sided). • Message - Kangaroo Inn Ruins • Symbols - Historic Refer to page 45 of WRC Strategy and page 49/ diagram 2			High Priority, Year 1
286	Brown Tourist Sign	-37.337419169663800	140.24927039554400	Tourist Information	Kangaroo Inn Historic Ruins	Intersection of	Beachport-Penola Rd	& Clay Wells Rd		Replace sign panel	• Replace Brown Positional sign (double sided). • Message - Kangaroo In Ruins • Symbols - Historic Refer to page 45 of WRC Strategy and page 49/ diagram 2			High Priority, Year 1

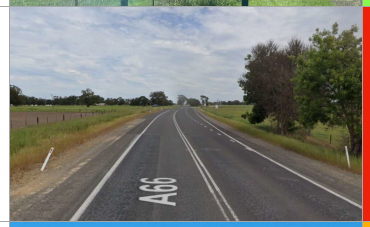
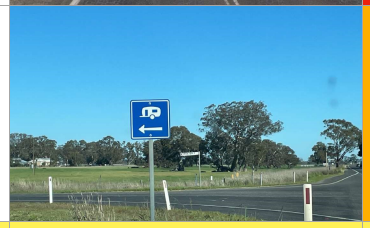
	Brown Tourist Sign			Advance Warning Sign	Kangaroo Inn Historic Ruins	Northbound	Clay Wells Rd			New Sign	• Install Brown Advance Warning sign. • Message - Kangaroo In Ruins • Symbols - Historic Refer to page 45 of WRC Strategy and page 49/ diagram 2			High Priority, Year 1
	Brown Tourist Sign			Advance Warning Sign	Kangaroo Inn Historic Ruins	Southbound	Clay Wells Rd			New Sign	• Install Brown Advance Warning sign. • Message - Kangaroo In Ruins • Symbols - Historic Refer to page 45 of WRC Strategy and page 49/ diagram 2			High Priority, Year 1
287	Various Signs	-37.32016616666670	140.16989216666700	Entry Statement Sign	Wattle Range Council	Southbound	Clay Wells Rd			Attention needed	Clean all boundary entry statements anually			High Priority, Ongoing
288	Brown Tourist Sign	-37.33772783333330	140.25225416666700	Fingerboard Sign	Post Office Tree	Southbound	Clay Wells Rd			New Sign	• Replace Brown Fingerboard sign. • Message - Post Office Tree • Symbols - Historic Refer to page 45 of WRC Strategy			High Priority, Year 1
	Beachport Penola Rd/Clay														
289	Various Signs	-37.402754000000000	140.33808283333300	Entry Statement Sign	Furner	Southbound	Conmurra Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2
290	Various Signs	-37.409111833333300	140.33530300000000	Entry Statement Sign	Furner	Northbound	Conmurra Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2
	Beachport Penola Rd/Clay														

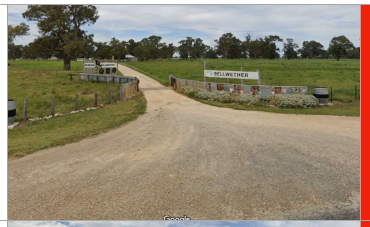
291	Green Directional Sign	-37.3564235	140.50289216666700	Advance Warning Sign	Penola	Westbound	Clay Wells Rd			No change				
292	Green Directional Sign	-37.356515333333300	140.503215	Reassurance Sign	Beachport 52	Westbound	Clay Wells Rd			No change				
293	Green Directional Sign	-37.356501666666700	140.50804666666700	Reassurance Sign	Penola 29	Eastbound	Clay Wells Rd			Attention needed	Clean Sign			High Priority, Ongoing
294	Green Directional Sign	-37.356595166666700	140.5082445	Directional Sign	Robe	Westbound	Clay Wells Rd			No change				
295	Brown Tourist Sign	-37.359826	140.68361683333300	Intersection Sign	St Marys	Intersection of	Clay Wells Rd	& Rifle Range Rd		No change				
296	Brown Tourist Sign			Advance Warning Sign	Penola Conservation Park	Eastbound	Clay Wells Rd			New Sign	• Brown Advance Warning sign. • Message - Penola Conservation Park • Symbols - Flora & Fauna			High Priority, Year 1

297	Brown Tourist Sign	-37.360025402839200	140.70375039879500	Fingerboard Sign	Penola Conservation Park	Intersection of	Clay Wells Rd			Replace sign panel	• Brown Positional sign. • Message - Penola Conservation Park • Symbols - Flora & Fauna			High Priority, Year 1
298	Brown Tourist Sign			Advance Warning Sign	Penola Conservation Park	Westbound	Clay Wells Rd			New Sign	• Brown Advance Warning sign. • Message - Penola Conservation Park • Symbols - Flora & Fauna			High Priority, Year 1
299	Green Directional Sign	-37.37354916666670	140.82369983333300	Reassurance Sign	Lucindale 74	Westbound	Clay Wells Rd			No change				
300	Green Directional Sign			Advance Warning Sign	Penola	Eastbound	Clay Wells Rd							
301	Green Directional Sign	-37.373278166666700	140.82727733333300	Intersection Sign	Naracoorte	Intersection of	Clay Wells Rd	& Riddoch Hwy		No change				
	Beachport Penola Rd/Clay Wells Rd													
	Riddoch Hwy													
302	Various Signs	-37.17960133333330	140.83849533333300	Entry Statement Sign	Wattle Range Council	Southbound	Riddoch Hwy			No change	Clean all boundary entry statements annually			High Priority, Ongoing

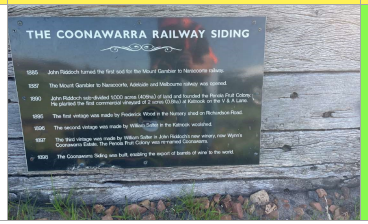
303	Brown Tourist Sign	-37.193257500000000	140.84178550000000	Advance Warning Sign	Father Woods Park	Southbound	Riddoch Hwy			Replace sign panel	• Replace Brown Advance Warning sign. • Message - Father Woods Park • Symbols - Historic & Monument Refer to page 41 of WRC Strategy			High Priority, Year 1
304	Brown Tourist Sign	-37.19602883333330	140.84407516666700	Fingerboard Sign	Father Woods Tree	Northbound	Riddoch Hwy			No change	Refer to page 41 of WRC Strategy			
305	Brown Tourist Sign	-37.19621841647620	140.8440133809920	Intersection Sign	Father Woods Park	Southbound	Riddoch Hwy			Replace sign panel	• Install Brown Positional sign (double sided) • Message - Father Woods Park • Symbols - Historic & Monument Refer to page 41 of WRC Strategy			High Priority, Year 1
306	Interpretive Sign	-37.19613627139530	140.84443515332000	Interpretive Sign	Various	Southbound	Riddoch Hwy			Attention needed	Refer to page 41 of WRC Strategy			High Priority, Ongoing
307	Brown Tourist Sign	-37.19900233333330	140.847506	Advance Warning Sign	Father Woods Park	Northbound	Riddoch Hwy			Replace sign panel	• Replace Brown Advance Warning sign. • Message - Father Woods Park • Symbols - Historic & Monument Refer to page 41 of WRC Strategy			High Priority, Year 1
308	Green Directional Sign	-37.21877533333330	140.85530533333300	Advance Warning Sign	Penola	Southbound	Riddoch Hwy			No change				

309	Green Directional Sign	-37.21757216666670	140.8551485	Reassurance Sign	Naracoorte 31	Northbound	Riddoch Hwy			No change				
310	Green Directional Sign	-37.2205425	140.8549755	Intersection Sign	Naracoorte	Intersection of	Riddoch Hwy	& Edinhope Rd		No change				
	Riddoch Hwy/ Edenhope Rd														
311	Green Directional Sign	-37.22078316666670	140.857653	Advance Warning Sign	Naracoorte	Westbound	Edenhope Rd			No change				
312	Green Directional Sign	-37.22057483333330	140.859023	Reassurance Sign	Edenhope Rd	Eastbound	Edenhope Rd			No change				
313	Various Signs	-37.17847516666670	140.9084065	Entry Statement Sign	Wattle Range Council	Westbound	Edenhope Rd			No change	Clean all boundary entry statements annually			High Priority, Ongoing
	Riddoch Hwy/ Edenhope Rd														
314	Green Directional Sign	-37.22392766666670	140.8538815	Reassurance Sign	Coonawarra	Southbound	Riddoch Hwy			No change				

315	Green Directional Sign	-37.22324033333330	140.853929	Advance Warning Sign	Naracoorte	Northbound	Riddoch Hwy			No change				
316	Blue Services Sign			Advance Warning Sign	Coonawarra Bush Holiday Park	Southbound	Riddoch Hwy			New Sign	• Install Blue Advance Warning sign. • Message - Coonawarra Bush Holiday Park • Symbols - Caravan Refer to page 57 of WRC Strategy			High Priority, Year 1
317	Blue Services Sign	-37.22550716666670	140.85334516666700	Directional Sign	Caravan park	Intersection of	Riddoch Hwy	& Colmah School Rd		Replace sign panel	• Replace Blue Intersection sign. • Message - Coonawarra Bush Holiday Park • Symbols - Caravan Refer to page 57 of WRC Strategy			High Priority, Year 1
	Riddoch Hwy/ Colmah School Rd														
318	Blue Services Sign	-37.22649333333330	140.8802821666670	Fingerboard Sign	Caravan park	At Location	Colmah School Rd			Replace sign panel	• Replace Blue Positional sign. • Message - Coonawarra Bush Holiday Park • Symbols - Caravan Refer to page 57 of WRC Strategy			High Priority, Year 1
	Riddoch Hwy/ Colmah School Rd														
319	Blue Services Sign			Advance Warning Sign	Caravan park	Northbound	Riddoch Hwy			New Sign	• Install Blue Advance Warning sign. • Message - Coonawarra Bush Holiday Park • Symbols - Caravan Refer to page 57 of WRC Strategy			High Priority, Year 1
320	Blue Services Sign			Advance Warning Sign	Bellwether Estate	Southbound	Riddoch Hwy			New Sign	• Install Blue Advance Warning sign. • Message - Bellwether Estate • Symbols - Caravan Refer to page 57 of WRC Strategy			High Priority, Year 1

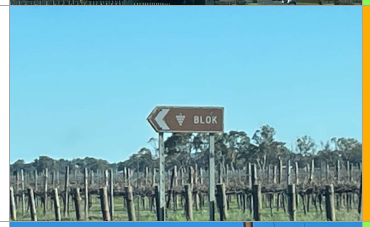
321	Blue Services Sign			Intersection Sign	Bellwether Estate	At Location	Riddoch Hwy			New Sign	• Install Blue Positional sign. • Message - Bellwether Estate • Symbols - Caravan Refer to page 57 of WRC Strategy			High Priority, Year 1
322	Brown Tourist Sign			Advance Warning Sign	Bellwether Estate	Northbound	Riddoch Hwy			New Sign	• Install Blue Advance Warning sign. • Message - Bellwether Estate • Symbols - Caravan Refer to page 57 of WRC Strategy			High Priority, Year 1
323	Brown Tourist Sign	-37.248737	140.83826716666700	Intersection Sign	Rymill	Southbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Rymill • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
	Blue Services Sign			Directional Sign	Rest Area	Southbound	Riddoch Hwy			New Sign	• Install Blue Advance Warning sign. • Message - Rest Area • Symbols - Rest Area Refer to page 57 of WRC Strategy			Low Priority, Year 3
	Blue Services Sign			Directional Sign	Rest Area	Southbound	Riddoch Hwy			New Sign	• Install Blue Positional sign. • Message - Rest Area • Symbols - Rest Area Refer to page 57 of WRC Strategy			Low Priority, Year 3
324	Blue Services Sign	-37.26880460695900	140.83721551617400	Directional Sign	Rest Area	Northbound	Southern Ports Hwy			No change				

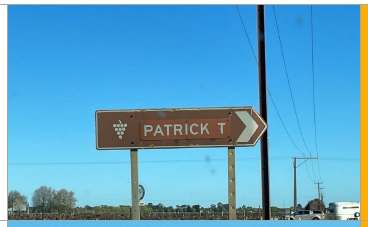
327	Blue Services Sign	-37.269616	140.83755483333300	Directional Sign	Rest Area	Northbound	Riddoch Hwy			No change				
326	Blue Services Sign	-37.272823000000000	140.83775216666700	Advance Warning Sign	Rest Area	Northbound	Riddoch Hwy			No change				
325	Green Directional Sign	-37.27364366666670	140.83794583333300	Advance Warning Sign	Lynch Rd	Southbound	Riddoch Hwy			Attention needed	Clean sign Refer to page 31 of WRC Strategy			High Priority, Ongoing
328	Brown Tourist Sign	-37.27632383333330	140.83811383333300	Intersection Sign	Penney Estate	Intersection of	Riddoch Hwy	& McLean Rd		Replace sign panel	Replace airstrip panel Refer to page 31 of WRC Strategy			Low Priority, Year 3
329	Green Directional Sign	-37.279900500000000	140.83821233333300	Advance Warning Sign	McLeans Rd	Northbound	Riddoch Hwy			Attention needed	Sign needs cleaning			High Priority, Ongoing
330	Blue Services Sign	-37.27889533333330	140.83814900000000	Advance Warning Sign	Rest Area 1km	Northbound	Riddoch Hwy			Attention needed	Sign needs cleaning			High Priority, Ongoing

331	Brown Tourist Sign	-37.2856015	140.83869383333300	Intersection Sign	Redman	Southbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Redman • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
332	Brown Tourist Sign	-37.28827583333330	140.83887266666700	Intersection Sign	Brands Laira	Southbound	Riddoch Hwy			No change	Refer to page 31 of WRC Strategy			
334	Brown Tourist Sign	-37.28969233333330	140.838957	Advance Warning Sign	Coonawarra	Southbound	Riddoch Hwy			Attention needed	Sign panel damaged Refer to page 31 of WRC Strategy			
335	Brown Tourist Sign	-37.28969233333330	140.838957	Intersection Sign	Coonawarra???	Intersection of	Riddoch Hwy	& Memorial Drive		Replace sign panel	Sign panel faded • Replace Brown Positional signs. • Message 1 - Coonawarra Centenary Sculpture • Message 2 - Redman • Symbols - Wine Refer to page 31 & 44 of WRC Strategy			High Priority, Year 1
336	Blue Services Sign	-37.292076333333300	140.83854533333300	Directional Sign	Fire/barbecue	Intersection of	Riddoch Hwy	& Memorial Dr		No change	Wrong location sign panel and toilet sign should be relocated to the other side of the road (sign location 319)			Low Priority, Year 3
	Riddoch Hwy/ Memorial Drive													
337	Interpretive Sign	-37.291859560028200	140.82022947940400	Interpretive Sign	Coonawarra Railway Siding	At Location	Memorial Dr			No change	Refer to page 44 of WRC Strategy			

338	Brown Tourist Sign	-37.29116713165990	140.8297850658570	Intersection Sign	Wynns	Eastbound	Memorial Dr			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Wynns • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
339	Interpretive Sign	-37.29142914239850	140.83224697219400	Interpretive Sign	Hoffs Block	Eastbound	Memorial Dr			No change				
	Riddoch Hwy/ Memorial Drive													
340	Brown Tourist Sign	-37.29353366666670	140.83920566666700	Intersection Sign	Digiorgio	Southbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Digiorgio • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
341	Green Directional Sign	-37.2941125	140.83908083333300	Advance Warning Sign	Coonawarra	Northbound	Riddoch Hwy			No change	Refer to page 31 of WRC Strategy			
342	Brown Tourist Sign	-37.295761666666700	140.83935033333300	Intersection Sign	Zema	Southbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Digiorgio • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
343	Green Directional Sign	-37.320212	140.84087666666700	Advance Warning Sign	V&A Lane	Southbound	Riddoch Hwy			Attention needed	Clean sign Refer to page 31 of WRC Strategy			

344	Brown Tourist Sign	-37.322857500000000	140.84105733333300	Intersection Sign	Majella	Intersection of	Riddoch Hwy	& V&A Lane		Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Majella • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
345	Brown Tourist Sign	-37.322857500000000	140.84105733333300	Intersection Sign	St Mary's	Intersection of	Riddoch Hwy	& V&A Lane		Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Digiorgio • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
346	Brown Tourist Sign	-37.32293116666670	140.84106000000000	Intersection Sign	Punters Retreat	Intersection of	Riddoch Hwy	& V&A Lane		Replace sign panel	Wrong colour should be a blue sign • Blue Positional sign. • Message - Punters Retreat • Symbols - Accomodation Refer to page 58 of WRC Strategy			High Priority, Year 1
347	Brown Tourist Sign	-37.32597116666670	140.8411045	Advance Warning Sign	V&A Lane	Northbound	Riddoch Hwy			Attention needed	Clean sign Refer to page 31 of WRC Strategy			High Priority, Ongoing
348	Brown Tourist Sign	-37.328459000000000	140.84142966666700	Intersection Sign	Katnook	Southbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Katnook • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
349	Blue Services Sign	-37.33587966666670	140.84199000000000	Advance Warning Sign	Penola 5	Southbound	Riddoch Hwy			No change				

350	Brown Tourist Sign	-37.338357000000000	140.843313	Intersection Sign	Highbank	Southbound	Riddoch Hwy			No change	Refer to page 31 of WRC Strategy				
351	Brown Tourist Sign	-37.34128583333330	140.8444385	Intersection Sign	Leconfield	Southbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Leconfield • Symbols - Wine Refer to page 31 of WRC Strategy				Medium Priority, Year 2
352	Brown Tourist Sign	-37.34278183333330	140.84423033333300	Intersection Sign	Bowen Estate	Northbound	Riddoch Hwy			No change					
353	Brown Tourist Sign	-37.34680516666670	140.84313633333300	Intersection Sign	Balnaves	Northbound	Riddoch Hwy			No change					
354	Brown Tourist Sign	-37.348301166666700	140.84295066666700	Intersection Sign	Blok	Northbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Leconfield • Symbols - Wine Refer to page 31 of WRC Strategy				Medium Priority, Year 2
355	Green Directional Sign	-37.353547000000000	140.84175200000000	Advance Warning Sign	Mt Gambier	Southbound	Riddoch Hwy			No change					

356	Brown Tourist Sign	-37.3540955	140.84162783333300	Intersection Sign	Patrick T	Southbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Patrick T • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
357	Brown Tourist Sign	-37.3548035	140.84145950000000	Intersection Sign	Hollick	Northbound	Riddoch Hwy			Replace sign panel	Sign panel faded • Replace Brown Positional sign. • Message - Leconfield • Symbols - Wine Refer to page 31 of WRC Strategy			Medium Priority, Year 2
358	Brown Tourist Sign	-37.35581066666670	140.84123333333300	Advance Warning Sign	Penola Attractions	Southbound	Riddoch Hwy			No change				
359	Green Directional Sign	-37.35964583333330	140.8403358333330	Advance Warning Sign	Mt Gambier	Southbound	Riddoch Hwy			No change				
360	Brown Tourist Sign	-37.360094833333300	140.84019983333300	Advance Warning Sign	Parker Estate	Southbound	Riddoch Hwy			No change				
361	Various Signs	-37.360503666666700	140.840014	Entry Statement Sign	Penola	Southbound	Riddoch Hwy			No change				

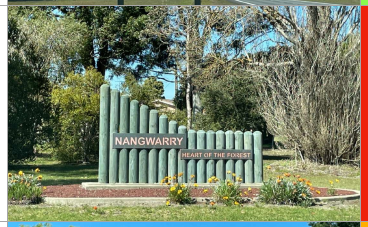
362	Green Directional Sign	-37.362024	140.83893983333300	Intersection Sign	Penola	Intersection of	Riddoch Hwy	& Penola Bypass		No change				
363	Green Directional Sign	-37.36433683333330	140.835373	Intersection Sign	Penola	Northbound	Riddoch Hwy			No change				
364	Brown Tourist Sign	-37.36362183333330	140.83642866666700	Advance Warning Sign	Parker Estate	Northbound	Riddoch Hwy			No change				
365	Green Directional Sign	-37.362420166666700	140.83821283333300	Intersection Sign	Penola	Intersection of	Riddoch Hwy	& Penola Bypass		No change				
366	Brown Tourist Sign	-37.362123	140.8385485	Intersection Sign	Parker Estate	Northbound	Riddoch Hwy			No change				
367	Green Directional Sign	-37.37088133333330	140.82842966666700	Directional Sign	Mt Gambier	Southbound	Riddoch Hwy			No change				

368	Green Directional Sign	-37.373247	140.82804533333300	Intersection Sign	Robe	Intersection of	Riddoch Hwy	& Clay Wells Rd		No change				
369	Green Directional Sign	-37.373247	140.82804533333300	Intersection Sign	Penola	Intersection of	Riddoch Hwy	& Robe Rd		No change				
370	Green Directional Sign	-37.37618316666670	140.82725316666700	Directional Sign	Keith	Northbound	Riddoch Hwy			No change				
371	Green Directional Sign	-37.37447668517030	140.82758176908500	Intersection Sign	Penola	Intersection of	Riddoch Hwy	& Penola		No change				
372	Green Directional Sign	-37.37403842606760	140.82769065131200	Intersection Sign	Robe	Intersection of	Riddoch Hwy	& Clay Wells Rd		No change				
373	Green Directional Sign	-37.38023533333330	140.8266705	Advance Warning Sign	Mt Gambier	Southbound	Riddoch Hwy			No change				

374	Green Directional Sign	-37.38321933333330	140.82733266666700	Intersection Sign	Millicent	Intersection of	Riddoch Hwy	& Mt Burr Rd		No change				
375	Green Directional Sign	-37.389147	140.83479566666700	Intersection Sign	Penola	Intersection of	Riddoch Hwy	& Penola Bypass		No change				
376	Brown Tourist Sign	-37.3899705	140.8359265	Advance Warning Sign	Greenrise Reserve	Southbound	Riddoch Hwy			No change				
377	Brown Tourist Sign	-37.39190821301110	140.83744768590700	Intersection Sign	Greenrise Reserve	Southbound	Riddoch Hwy			No change				
378	Green Directional Sign	-37.39319316666670	140.8381645	Reassurance Sign	Mt Gambier 50	Southbound	Riddoch Hwy			No change				
379	Green Directional Sign	-37.40616566666670	140.839324	Advance Warning Sign	Penola Bypass	Northbound	Riddoch Hwy			No change				

380	Brown Tourist Sign	-37.397108333333300	140.83872666666700	Advance Warning Sign	Penola Attractions	Northbound	Riddoch Hwy			No change				
381	Brown Tourist Sign	-37.394646000000000	140.83870066666700	Advance Warning Sign	Greenrise Reserve	Northbound	Riddoch Hwy			No change				
382	Green Directional Sign	-37.39274416666670	140.837748	Advance Warning Sign	Naracoorte	Northbound	Riddoch Hwy			No change				
383	Various Signs	-37.391089666666700	140.83674033333300	Entry Statement Sign	Penola	Northbound	Riddoch Hwy			No change				
384	Green Directional Sign	-37.3897105	140.83527600000000	Intersection Sign	Penola	Intersection of	Riddoch Hwy	& Penola Bypass		No change				
385	Green Directional Sign	-37.462329000000000	140.83172766666700	Advance Warning Sign	Krongart Rd	Southbound	Riddoch Hwy			No change				

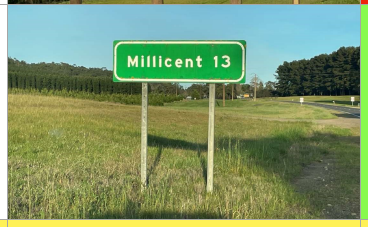
386	Green Directional Sign	-37.4655285	140.831573	Intersection Sign	Casterton	Intersection of	Riddoch Hwy	& Krongacart Rd		No change				
387	Green Directional Sign	-37.46907233333330	140.8308775	Advance Warning Sign	Penola	Northbound	Riddoch Hwy			No change				
388	Green Directional Sign	-37.46827	140.830998	Advance Warning Sign	Tower Rd	Northbound	Riddoch Hwy			No change				
389	Blue Services Sign	-37.49646583333330	140.8217645	Advance Warning Sign	Nangwarry 5	Southbound	Riddoch Hwy			Replace sign panel	Sign panel damaged			Low Priority, Year 3
390	Blue Services Sign	-37.506065	140.8186615	Advance Warning Sign	Forestry	Southbound	Riddoch Hwy			Replace sign panel	• At the Forestry information bay replace blue signs with brown tourism directional signs. • Clean site and cut the grass.			Medium Priority, Year 2
391	Blue Services Sign	-37.51044983333330	140.8177821666670	Directional Sign	Forestry information bay	Southbound	Riddoch Hwy			Replace sign panel	• At the Forestry information bay replace blue signs with brown tourism directional signs. • Clean site and cut the grass.			Medium Priority, Year 2

392	Interpretive Sign	-37.510829104226000	140.81859540743300	Interpretive Sign	Forestry	At Location	Riddoch Hwy			No change	• At the Forestry information bay replace blue signs with brown tourism directional signs. • Clean site and cut the grass.				
393	Green Directional Sign	-37.534806	140.81524616666700	Reassurance Sign	Penola 18	Northbound	Riddoch Hwy			No change					
394	Various Signs	-37.53765733333330	140.81510166666700	Entry Statement Sign	Nangwarry	Southbound	Riddoch Hwy			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy				Medium Priority, Year 2
395	Blue Services Sign	-37.53932566666670	140.81502583333300	Fingerboard Sign	Museum	Intersection of	Riddoch Hwy	& Coombe St		Replace sign panel	• Replace Museum sign with Brown Fingerboard sign • Message - Museum • Symbol - Museum				Medium Priority, Year 2
396	Various Signs	-37.539412082589500	140.81536344117500	Entry Statement Sign	Forestry Museum	At Location	Riddoch Hwy			Replace sign panel	• Replace Museum sign with Brown Positional sign • Message - Museum • Symbol - Museum				Medium Priority, Year 2
397	Blue Services Sign	-37.53947616666670	140.81533316666700	Fingerboard Sign	Museum	At Location	Riddoch Hwy			Replace sign panel	• Replace Museum sign with Brown Fingerboard sign • Message - Museum • Symbol - Museum				Medium Priority, Year 2

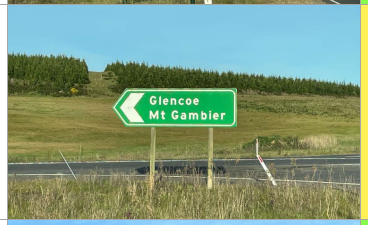
398	Green Directional Sign	-37.547068666666700	140.81423216666700	Advance Warning Sign	Mt Gambier	Southbound	Riddoch Hwy			No change				
399	Green Directional Sign	-37.54822870074960	140.8140138052540	Intersection Sign	Kalangadoo	Southbound	Riddoch Hwy			No change				
400	Green Directional Sign	-37.552891	140.8135711666670	Reassurance Sign	Mt Gambier	Southbound	Riddoch Hwy			No change				
401	Blue Services Sign	-37.58278383333330	140.80746250000000	Advance Warning Sign	Tarpeena 5	Southbound	Riddoch Hwy			Replace sign panel	Sign panel damaged			Low Priority, Year 3
402	Blue Services Sign	-37.586087500000000	140.8068125	Advance Warning Sign	Nangwarry 5	Northbound	Riddoch Hwy			Attention needed	Sign needs cleaning			High Priority, Ongoing
403	Green Directional Sign	-37.55483333124800	140.81320436857700	Advance Warning Sign	Penola	Northbound	Riddoch Hwy			No change				

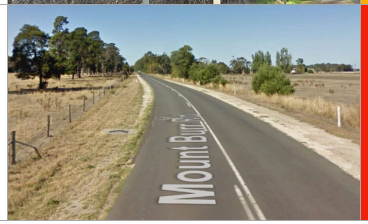
404	Green Directional Sign	-37.550329535957000	140.81365291797300	Intersection Sign	Kalangadoo	Intersection of	Riddoch Hwy	& Nangwarry Rd		No change				
405	Green Directional Sign	-37.54936094230820	140.81141963284300	Advance Warning Sign	Mt Gambier	Eastbound	Nangwarry Rd			No change				
406	Green Directional Sign	-37.54952027397740	140.8085993708130	Reassurance Sign	Kalangadoo 11	Westbound	Nangwarry Rd			No change				
407	Various Signs	-37.60781683333330	140.80414283333300	Entry Statement Sign	Wattle Range Council	Northbound	Riddoch Hwy			Attention needed	Clean all boundary entry statements annually			High Priority, Ongoing
	Mt Burr Rd (West to East)													
408	Green Directional Sign	-37.59464458303930	140.3531727171220	Reassurance Sign	Mt Burr 10	Eastbound	Mt Burr Rd			No change				
409	Various Signs	-37.589140707350400	140.35992146569000	Entry Statement Sign	Welcome to Millicent	Westbound	Mt Burr Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2

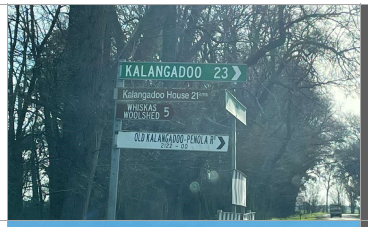
410	Blue Services Sign	-37.5895789046198	140.35898072856400	Advance Warning Sign	Visitor Center 1km	Westbound	Mt Burr Rd			Attention needed	Refer to page 72 of WRC Strategy			Medium Priority, Year 2
411	Green Directional Sign	-37.58367096451560	140.37263313316200	Advance Warning Sign	Penola	Eastbound	Mt Burr Rd			No change				
412	Blue Services Sign			Advance Warning Sign	Millicent Golf Course 300m	Eastbound	Mt Burr Rd			New Sign	• Install blue advance warning signs positioned 300m each side of the intersection. • Message - Millicent Golf Course • Symbol - Golf			High Priority, Year 1
413	Blue Services Sign			Intersection Sign	Millicent Golf Course	Intersection of	Mt Burr Rd	& Golf Course Rd		New Sign	• Install double sided blue intersection sign.			High Priority, Year 1
414	Blue Services Sign			Advance Warning Sign	Millicent Golf Course 300m	Westbound	Mt Burr Rd			New Sign	• Install blue advance warning signs positioned 300m each side of the intersection. • Message - Millicent Golf Course • Symbol - Golf			High Priority, Year 1
415	Various Signs	-37.54469550588020	140.44275856777800	Entry Statement Sign	Welcome to Mt Burr	Eastbound	Mt Burr Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2

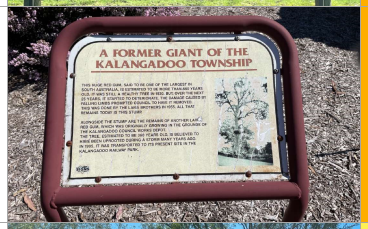
416	Various Signs	-37.540782429312900	140.46543077578800	Entry Statement Sign	Welcome to Mt Burr	Westbound	Mt Burr Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2
417	Green Directional Sign	-37.54019483333330	140.47139733333300	Advance Warning Sign	Millicent 13	Westbound	Mt Burr Rd			No change				
	Mt Burr Rd (Wattle Range & Overland													
418	Green Directional Sign	-37.54014316666670	140.4726925	Advance Warning Sign	Kalangadoo	Eastbound	Mt Burr Rd			No change				
419	Green Directional Sign	-37.540280333333300	140.4752573333330	Intersection Sign	Lucindale	Intersection of	Mt Burr Rd	& Wattle Range Rd		Attention needed	Sign needs cleaning			High Priority, Ongoing
420	Green Directional Sign	-37.538508666666700	140.47595666666700	Advance Warning Sign	Millicent	Southbound	Wattle Range Rd	& Mt Burr Rd		No change				
421	Green Directional Sign	-37.5396948076469	140.47582528795900	Intersection Sign	Millicent	Intersection of	Mt Burr Rd	& Wattle Range Rd		No change				

422	Interpretive Sign	-37.53977739978450	140.47605320881100	Interpretive Sign	Southern Bent Wing Bat	Intersection of	Mt Burr Rd	& Wattle Range Rd		No change				
423	Green Directional Sign	-37.54046544999850	140.47601506556900	Intersection Sign	Lucindale	Intersection of	Mt Burr Rd	& Wattle Range Rd		No change				
424	Green Directional Sign	-37.54040276361710	140.47779484621100	Intersection Sign	Glencoe	Intersection of	Mt Burr Rd	& Overland Track Rd		No change				
425	Brown Tourist Sign	-37.54125830300280	140.4786760250150	Intersection Sign	Gran Gran Historical Grave Site	Southbound	Overland Track Rd			No change				
426	Green Directional Sign	-37.54265124697660	140.47941877702500	Advance Warning Sign	Penola	Northbound	Overland Track Rd			No change				
427	Green Directional Sign	-37.540137544194000	140.48254669299800	Reassurance Sign	Kalangadoo	Eastbound	Mt Burr Rd			No change				

428	Green Directional Sign	-37.5404235745814	140.48129972996300	Advance Warning Sign	Millicent	Westbound	Mt Burr Rd			No change				
429	Green Directional Sign	-37.54056407737940	140.47869927827700	Intersection Sign	Glencoe	Intersection of	Mt Burr Rd	& Overland Track Rd		Attention needed	Sign needs cleaning			High Priority, Ongoing
430	Green Directional Sign	-37.540555393828400	140.47869186322700	Intersection Sign	Penola	Intersection of	Mt Burr Rd	& Overland Track Rd		No change				
	Mt Burr Rd/Wattle Range & Overland													
	Mt Burr Rd/Mt MacIntyre Rd													
431	Green Directional Sign	-37.53379814815300	140.49632358344000	Advance Warning Sign	Penola	Eastbound	Mt Burr Rd			No change				
432	Green Directional Sign	-37.53286279299170	140.49915803966700	Intersection Sign	Kalangadoo	Intersection of	Mt Burr Rd	& Mt MacIntyre Rd		Replace sign panel	Refer to page 22 of WRC Strategy			Low Priority, Year 3
433	Green Directional Sign	-37.5343806080232	140.50356166512500	Reassurance Sign	Kalangadoo 19	Southbound	Mount McIntyre Rd			No change				

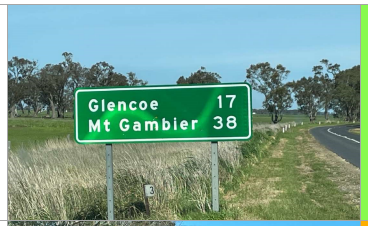
434	Green Directional Sign	-37.53412466666670	140.50206366666700	Advance Warning Sign	Penola	Northbound	Mount McIntyre Rd			No change				
	Mt Burr Rd/Mt MacIntyre Rd														
435	Green Directional Sign	-37.53148	140.50332233333300	Reassurance Sign	Penola	Eastbound	Mt Burr Rd			No change				
436	Green Directional Sign	-37.53148	140.50332233333300	Advance Warning Sign	Millicent	Westbound	Mt Burr Rd			No change				
437	Brown Tourist Sign			Advance Warning Sign	Yallum Park	Eastbound	Mt Burr Rd			New Sign	• Install Brown Advance warning sign • Message - Yallum Park 300m • Symbol - Historic Refer to page 44 & 49 of WRC Strategy	 	High Priority, Year 1
438	Brown Tourist Sign	-37.39730333333330	140.75819683333300	Intersection Sign	Yallum Park	At Location	Mt Burr Rd			Replace sign panel	• Install Brown Positional sign (double sided) • Message - Yallum Park 300m • Symbol - Historic Refer to page 44 & 49 of WRC Strategy	 	High Priority, Year 1
439	Brown Tourist Sign			Advance Warning Sign	Yallum Park	Westbound	Mt Burr Rd			New Sign	• Install Brown Advance warning sign • Message - Yallum Park 300m • Symbol - Historic Refer to page 44 & 49 of WRC Strategy	 	High Priority, Year 1

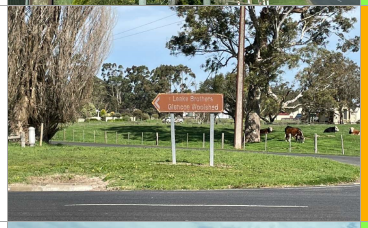
440	Various Signs	-37.39340516666670	140.76761400000000	Fingerboard Sign	Various	Intersection of	Mt Burr Rd	& Old Kalangadoo-Penola Rd		Remove sign	Remove - Kalangadoo House Remove - Whiska's Woolshead Refer to page 58 of WRC Strategy			High Priority, Year 1
441	Blue Services Sign	-37.422705833333300	140.731823	Fingerboard Sign	Wiskas Woolshed	Intersection of	Old Kalangadoo-Penola Rd	& Glen Yallum Rd		Remove sign	Remove - Whiska's Woolshead Refer to page 58 of WRC Strategy			High Priority, Year 1
442	Various Signs	-37.386603	140.81630116666700	Entry Statement Sign	Welcome to Penola	Eastbound	Mt Burr Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2
443	Green Directional Sign	-37.384531833333300	140.82345033333300	Advance Warning Sign	Penola	Eastbound	Mt Burr Rd			No change				
444	Green Directional Sign	-37.38501000000000	140.82208600000000	Reassurance Sign	Millicent 49	Westbound	Mt Burr Rd			No change				
445	Brown Tourist Sign	-37.38339116666670	140.8271445	Fingerboard Sign	Yallum Park 6	Intersection of	Riddoch Hwy	& Mt Burr Rd		Replace sign panel	• Replace with larger double sided intersection sign • Message Yallum Park 6 • Symbol - Historic Refer to page 44 & 49 of WRC Strategy			High Priority, Year 1
	Mt Burr Rd													
	Kalangadoo/ Glencoe/Lake													

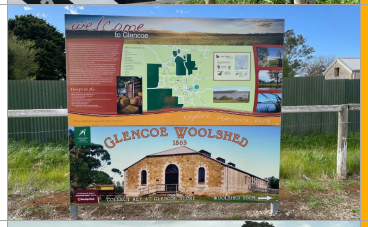
446	Various Signs	-37.56538479697510	140.7065055907300	Entry Statement Sign	Kalangadoo	Westbound	Nangwarry Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy				Medium Priority, Year 2
447	Green Directional Sign	-37.56381505854980	140.69896179242100	Intersection Sign	Millicent	Intersection of	Nangwarry Rd	& Railway Tce		Replace sign panel	Replace old faded sign panels Refer to page 20 & 22of WRC Strategy				Medium Priority, Year 2
448	Various Signs	-37.56419966666670	140.69818283333300	Tourist Information	Welcome to Kalangadoo	Westbound	Railway Tce			Replace sign panel	• Standardise all visitor information bay signage • Refer to page 69 of WRC Strategy				Medium Priority, Year 2
449	Interpretive Sign	-37.563951833333300	140.69850283333300	Interpretive Sign	A Former Giant	At Location	Railway Tce			Replace sign panel	Refer to page 75 of WRC Strategy Sign panel faded and damaged				Low Priority, Year 3
450	Green Directional Sign	-37.5644945	140.69809166666700	Advance Warning Sign	Nangwarry	Northbound	Railway Tce			Attention needed	Sign needs cleaning				High Priority, Ongoing
451	Various Signs	-37.56544483333330	140.69320833333300	Entry Statement Sign	Kalangadoo	Eastbound	Kangaroo Flat Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy				Medium Priority, Year 2

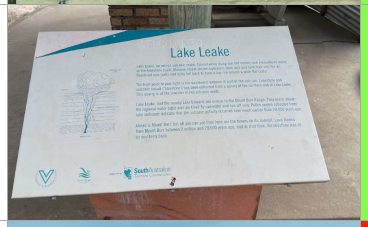
452	Green Directional Sign			Fingerboard Sign	Penola 29	Intersection of	Kangaroo Flat Rd	& Factory Rd		Attention needed	Sign needs cleaning			High Priority, Ongoing
453	Green Directional Sign			Fingerboard Sign	Bowling Club	Intersection of	Kangaroo Flat Rd	& Factory Rd		Attention needed	Sign needs cleaning			High Priority, Ongoing
454	Green Directional Sign	-37.56573166666670	140.68111583333300	Advance Warning Sign	Glencoe	Westbound	Kangaroo Flat Rd			No change				
455	Green Directional Sign	-37.5657775	140.67827366666700	Intersection Sign	Millicent	Intersection of	Kangaroo Flat Rd	& Mt McIntyre Rd		No change				
456	Green Directional Sign	-37.56290633333330	140.67798016666700	Reassurance Sign	Mt Burr	Northbound	Mount McIntyre Rd			No change				
457	Green Directional Sign	-37.562049333333300	140.67805866666700	Advance Warning Sign	Glencoe	Southbound	Mount McIntyre Rd			No change				

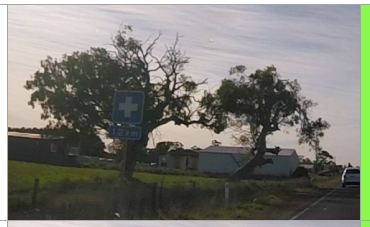
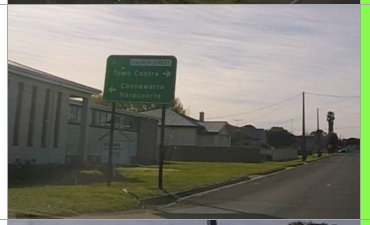
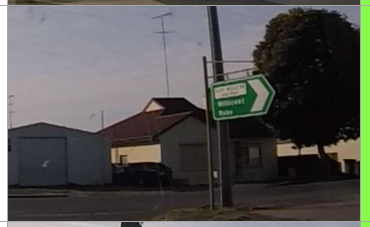
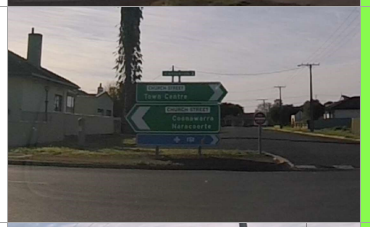
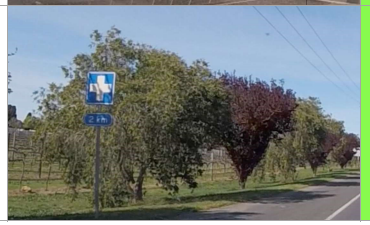
458	Green Directional Sign	-37.5645915	140.67812583333300	Intersection Sign	Kalangadoo	Intersection of	Mount McIntyre Rd	& Kangaroo Flat Rd		No change				
459	Green Directional Sign	-37.56581633333330	140.674962	Advance Warning Sign	Glencoe	Westbound	Kangaroo Flat Rd			Replace sign panel	Sign panel faded			Low Priority, Year 3
460	Green Directional Sign	-37.565829748066700	140.67297599855500	Intersection Sign	Glencoe	Intersection of	Kangaroo Flat Rd	& Rogers Rd		Replace sign panel	Sign panel faded Refer to page 22 of WRC Strategy			Low Priority, Year 3
461	Green Directional Sign			Intersection Sign	Kalangadoo	Intersection of	Kangaroo Flat Rd	& Rogers Rd		No change				
462	Green Directional Sign	-37.56572233333330	140.6761485	Advance Warning Sign	Kalangadoo	Eastbound	Kangaroo Flat Rd			No change				
463	Green Directional Sign	-37.5683812521638	140.6729154047290	Advance Warning Sign	Kalangadoo	Northbound	Kangaroo Flat Rd			No change				

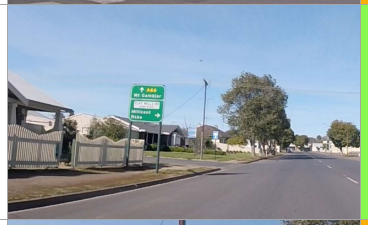
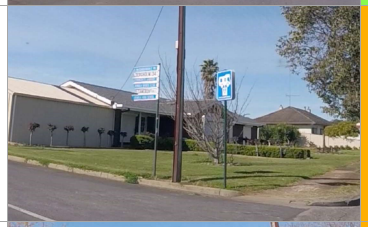
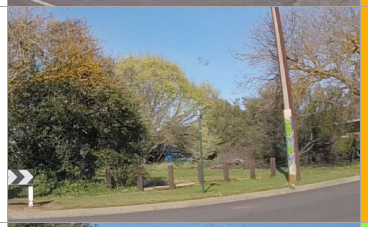
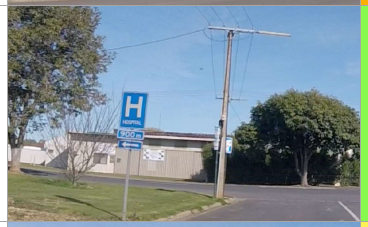
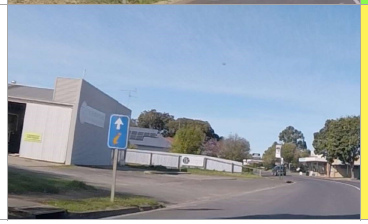
464	Green Directional Sign	-37.571182666666700	140.67302450000000	Reassurance Sign	Glencoe 17	Southbound	Kangaroo Flat Rd			No change					
465	Brown Tourist Sign	-37.66243266666670	140.63296650000000	Fingerboard Sign	Lake Edward	Intersection of	Kangaroo Flat Rd	& Kennedy Rd		Replace sign panel	• Replace with large intersection sign panel (double sided) • Message - Lake Edward • Symbols - Picnic & Hiking Refer to page 42 of WRC Strategy			High Priority, Year 1
466	Green Directional Sign	-37.68710633333330	140.62807733333300	Advance Warning Sign	Mt Gambier	Southbound	Kangaroo Flat Rd			Attention needed	Sign needs cleaning			High Priority, Ongoing
467	Green Directional Sign	-37.687269166666700	140.62796816666700	Reassurance Sign	Kalangadoo 17	Northbound	Kangaroo Flat Rd			Replace sign panel	Sign panel faded			Low Priority, Year 2
468	Green Directional Sign	-37.688875333333300	140.62807416666700	Intersection Sign	Glencoe	Intersection of	Kangaroo Flat Rd	& Medhurst Rd		Attention needed	Sign poles damaged, replace structure Refer to page 22 of WRC Strategy			Low Priority, Year 3
469	Various Signs	-37.72381433333330	140.67799783333300	Entry Statement Sign	Wattle Range Council	Northbound	Wandillo Forest Rd			Attention needed	Clean all boundary entry statements annually			Low Priority, Year 3

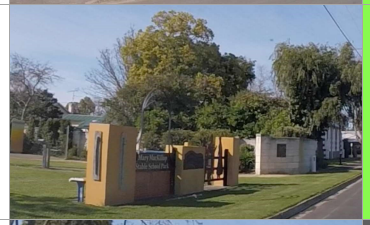
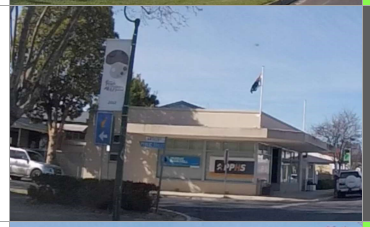
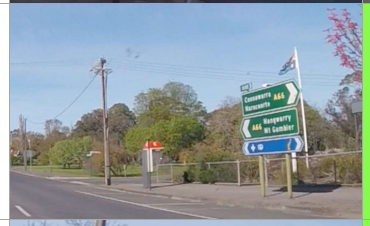
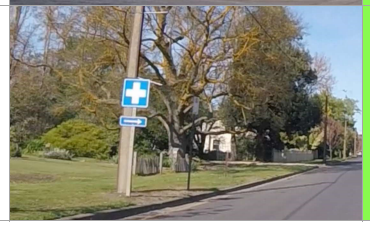
470	Various Signs	-37.689985666666700	140.61587733333300	Entry Statement Sign	Glencoe	Northbound	Glencoe Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2
471	Green Directional Sign	-37.68988066666670	140.61592550000000	Advance Warning Sign	Mt Gambier	Southbound	Glencoe Rd			No change				
472	Brown Tourist Sign	-37.687511069315500	140.6097158775750	Intersection Sign	Glencoe Woolshed	Intersection of	Glencoe Rd	& Lake Edward Rd		Replace sign panel	• Sign panel faded • Message - Glencoe Woolshed • Symbol - Historic Refer to page 42 of WRC Strategy			High Priority, Year 1
473	Green Directional Sign	-37.68771258783100	140.58186742524300	Intersection Sign	Millicent	Intersection of	Mile Hill/ Diagonal Rd	& Mile Hill Rd		No change				
474	Green Directional Sign	-37.68662159755300	140.580411741255	Advance Warning Sign	Mt Gambier	Southbound	Mile Hill/ Diagonal Rd			No change				
475	Brown Tourist Sign	-37.68688183333330	140.58078583333300	Trail Marker	Tourist Drive 73	Southbound	Mile Hill/ Diagonal Rd			Remove sign	Remove - Tourist Dr 73 no longer supported Refer to page 27 of WRC Strategy			High Priority, Year 1

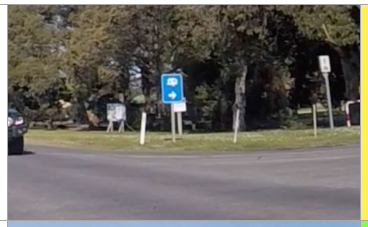
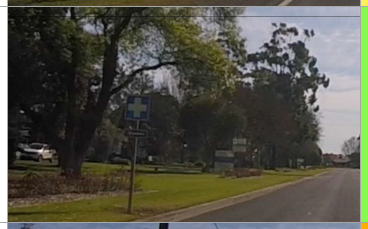
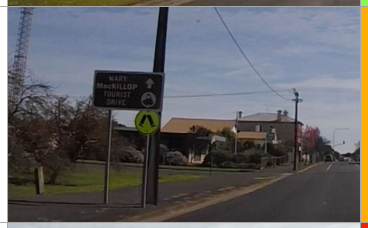
476	Various Signs	-37.67413664012420	140.58000768894400	Entry Statement Sign	Glencoe	Northbound	Glencoe West Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2
477	Various Signs	-37.67065751437450	140.58020149480200	Tourist Information	Welcome to Glencoe	At Location	Dow Rd			Replace sign panel	• Standardise all visitor information bay signage • Refer to page 69 of WRC Strategy			Medium Priority, Year 2
478	Brown Tourist Sign	-37.68763639036350	140.61146062811900	Intersection Sign	Glencoe Woolshed	Intersection of	Medhurst Rd	& The Springs Rd		Replace sign panel	• Sign panel faded • Message - Glencoe Woolshed • Symbol - Historic Refer to page 42 of WRC Strategy			High Priority, Year 1
479	Various Signs	-37.68759250589600	140.61134506002800	Tourist Information	Welcome to Glencoe	Intersection of	Medhurst Rd	& The Springs Rd		Replace sign panel	• Standardise all visitor information bay signage • Refer to page 69 of WRC Strategy			Medium Priority, Year 2
480	Brown Tourist Sign	-37.65893654435660	140.60962893081900	Fingerboard Sign	Lake Edward	Intersection of	Lake Edward Rd	& Kennedy Rd		Replace sign panel	• Replace with larger intersection sign panel • Message - Lake Edward • Symbols - Picnic & Hiking Refer to page 42 of WRC Strategy			High Priority, Year 1
481	Various Signs	-37.6324185	140.60189500000000	Fingerboard Sign	Lake Edward Rd	Intersection of	Lake Edward Rd	& Kennedy Rd		New Sign	• Replace with Blue Fingerboard sign • Message - Lake Edward • Symbols - None Refer to page 42 of WRC Strategy			Medium Priority, Year 2

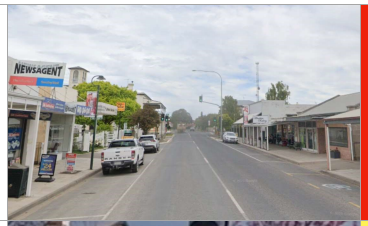
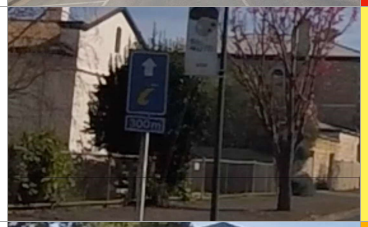
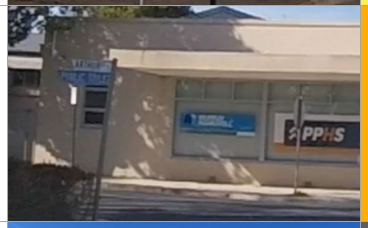
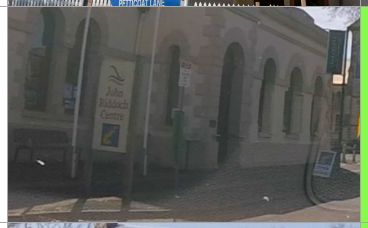
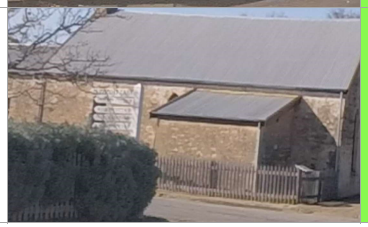
482	Brown Tourist Sign	-37.62706933333330	140.60185233333300	Tourist Information	Lake Edward Native Forest Reserve	At Location	Lake Edward			No change				
483	Various Signs	-37.610116833333300	140.60944533333300	Fingerboard Sign	Lake Edward Rd	Intersection of	Lake Edward	& Lake Leake Rd		New Sign	• Install Blue Fingerboard sign • Message - Lake Edward • Symbols - None Refer to page 42 of WRC Strategy			High Priority, Year 1
484	Various Signs	-37.61192883333330	140.59291683333300	Entry Statement Sign	Welcome to Lake Leake	At Location				No change				
485	Interpretive Sign	-37.61151366666670	140.59278383333300	Interpretive Sign	Lake Leake	At Location				No change				
486	Various Signs	-37.61027221568220	140.66325133333300	Fingerboard Sign	Lake Leake 6	Intersection of	Kangaroo Flat Rd	Old Medhurst Rd		New Sign	• Install large intersection sign panel • Message - Lake Edward • Symbols - Picnic & Hiking Refer to page 42 of WRC Strategy			High Priority, Year 1
	Kalangadoo/ Glencoe/Lake													
	Penola Town Centre													
487	Green Directional Sign	-37.365323500000000	140.83889933333300	Advance Warning Sign	Naracoorte	Northbound	Church St			No change				

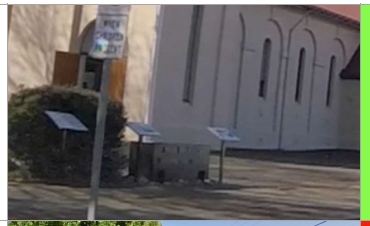
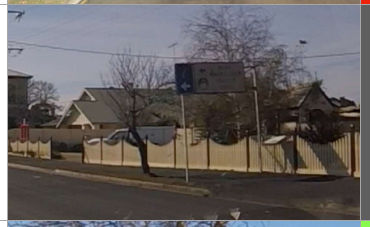
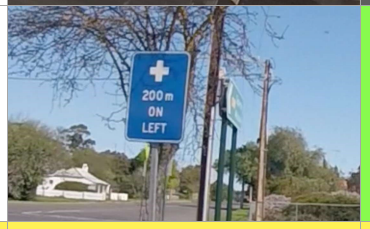
488	Blue Services Sign	-37.374148	140.828817	Directional Sign	Hospital	Eastbound	Robe Rd			No change				
489	Green Directional Sign	-37.375043	140.834911	Advance Warning Sign	Town Centre	Eastbound	Robe Rd			No change				
490	Green Directional Sign	-37.375476	140.836512	Intersection Sign	Millicent	Intersection of	Robe Rd	& Portland St		No change				
491	Green Directional Sign	-37.375376	140.836708	Intersection Sign	Town Centre	Intersection of	Robe Rd	& Portland st		No change				
492	Brown Tourist Sign	-37.366356	140.838816	Intersection Sign	Old Cemetery	Intersection of	Church St	Old Cemetery Rd		No change				
493	Blue Services Sign	-37.365589	140.839042	Directional Sign	Hospital 2km	Southbound	Church St			No change				

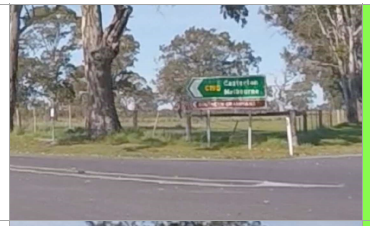
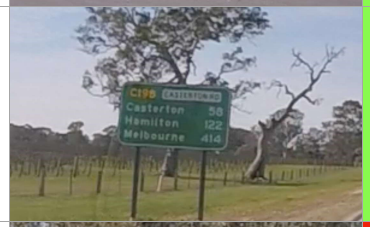
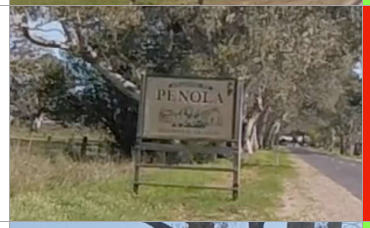
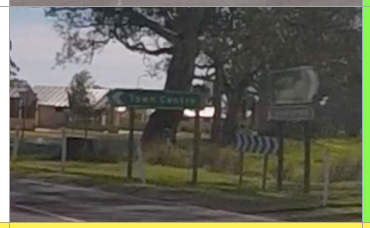
494	Blue Services Sign	-37.372188	140.837604	Directional Sign	Sports Complex	Southbound	Church St			Replace sign panel	• Install larger intersection sign panel (double sided) • Message - Sports Complex • Symbols - Picnic & Hiking Refer to page 42 of WRC Strategy			Medium Priority, Year 2
495	Green Directional Sign	-37.374422	140.837046	Advance Warning Sign	Mt Gambier	Southbound	Church St			No change				
496	Blue Services Sign	-37.374742	140.836871	Directional Sign	RV Dump Point	Intersection of	Church St	& Cameron St		Replace sign panel	• Install larger intersection sign panel (double sided) • Message - None • Symbols - RV Dump Point Refer to page 53 of WRC Strategy			High Priority, Year 1
497	Blue Services Sign	-37.375284	140.840433	Directional Sign	RV Dump Point	Intersection of	Cameron St	& Sports Ground entrance		Replace sign panel	• Install larger intersection sign panel (double sided) • Message - None • Symbols - RV Dump Point Refer to page 53 of WRC Strategy			High Priority, Year 1
498	Blue Services Sign	-37.37479	140.837257	Directional Sign	Hospital 900m	Intersection of	Cameron St	Church St		No change				
499	Blue Services Sign	-37.376214	140.83654	Directional Sign	Visitor Centre	Southbound	Church St			Attention needed	• Clean all directional signs, replace all damaged signage Refer to page 71 of WRC Strategy			Medium Priority, Year 2

500	Brown Tourist Sign	-37.377055	140.836513	Intersection Sign	Mary MacKillop Park	Intersection of	Church St	& Bowden St		No change				
501	Various Signs	-37.377599	140.835064	Entry Statement Sign	Mary MacKillop Park	Intersection of	Bowden St	Queen St		No change				
502	Blue Services Sign	-37.377904	140.836931	Directional Sign	Visitor Centre	Intersection of	Church St	& Arthur St		Remove sign	• Consolidate with sign 512 Refer to page 71 of WRC Strategy			
503	Green Directional Sign	-37.380831	140.837531	Intersection Sign	Coonawarra	Intersection of	Church St	& Julian St		No change				
504	Green Directional Sign	-37.380882	140.8377	Intersection Sign	Casterton	Intersection of	Church St	& Julian St		No change				
505	Blue Services Sign	-37.383246	140.837063	Directional Sign	Hospital	At Location	Church St			No change				

506	Blue Services Sign	-37.385771	140.835521	Directional Sign	Caravan Park	Intersection of	Church St	& South Tce		Attention needed	• Clean all directional signs, replace all damaged signage Refer to page 71 of WRC Strategy				High Priority, Ongoing
507	Green Directional Sign	-37.388556	140.83568	Advance Warning Sign	Millicent	Southbound	Church St			No change					
508	Blue Services Sign	-37.386076	140.835435	Directional Sign	Visitor Centre	Northbound	Church St			Attention needed	• Clean all directional signs, replace all damaged signage Refer to page 71 of WRC Strategy				Medium Priority, Year 2
509	Blue Services Sign	-37.38357	140.836748	Directional Sign	Hospital	Northbound	Church St			No change					
510	Brown Tourist Sign	-37.381483	140.837682	Advance Warning Sign	Mary MacKillop Tourist Dr	Northbound	Church St			Replace sign panel	• Replace existing Brown Advance Warning sign • Message Mary Mackillop Centre 200m • Refer to page 38 of WRC Strategy			High Priority, Year 1
510A	Brown Tourist Sign			Intersection Sign	Mary MacKillop Centre	Intersection of	Church St	Riddoch St		New Sign	• Install Brown Intersection sign (double sided) • Message - Mary Mackillop Centre • Symbol - Museum Refer to page 38 of WRC Strategy			High Priority, Year 1

510B	Brown Tourist Sign			Advance Warning Sign	Mary MacKillop Centre	Southbound	Church St			New Sign	• Install Brown Advance Warning sign (double sided) • Message - Mary Mackillop Centre 200m • Symbol - Museum Refer to page 38 of WRC Strategy			High Priority, Year 1
511	Blue Services Sign	-37.3804	140.8374	Directional Sign	Visitor Centre 500m	Northbound	Church St			Attention needed	• Clean all directional signs, replace all damaged signage Refer to page 71 of WRC Strategy			High Priority, Ongoing
512	Blue Services Sign	-37.377938	140.836905	Fingerboard Sign	Public Toilets	Intersection of	Church St	& Arthur St		Replace sign panel	• Install Blue Positional sign • Message - None • Symbols - Toilets			High Priority, Year 1
513	Brown Tourist Sign	-37.379943346639500	140.8376308625010	Advance Warning Sign	Woods-MacKillip Schoolhouse	Eastbound	Riddoch St			Remove sign	Old sign, wrong location Refer to page 38 of WRC Strategy			High Priority, Year 1
514	Various Signs	-37.377823	140.837789	Entry Statement Sign	John Riddoch Ctr	At Location	Arthur St			No change				
515	Various Signs	-37.379118	140.839011	Fingerboard Sign	Petticoat Lane	Intersection of	Portland St	& Petticoat Ln		No change	Refer to page 36 of WRC Strategy			

516	Various Signs	-37.379638	140.839159	Entry Statement Sign	Mary MacKillop Penola Ctr	At Location	Portland St			No change	Refer to page 38 of WRC Strategy			
516A	Brown Tourist Sign			Intersection Sign	Mary MacKillop Penola Ctr	Intersection of	Julian St	& Portland St		New Sign	• Install Brown Intersection sign (double sided) • Message - Mary Mackillop Centre • Symbol - Museum Refer to page 38 of WRC Strategy			High Priority, Year 1
516B	Brown Tourist Sign			Advance Warning Sign	Mary MacKillop Penola Ctr	Northbound	Julian St			New Sign	• Install Brown Advance Warning sign (double sided) • Message - Mary Mackillop Centre 200m • Symbol - Museum Refer to page 38 of WRC Strategy			High Priority, Year 1
517	Blue Services Sign	-37.380126	140.836666	Advance Warning Sign	Visitor Centre/ Mary MacKillop Dr	Eastbound				Remove sign	Refer to page 38 of WRC Strategy			High Priority, Year 1
518	Blue Services Sign	-37.380901	140.837822	Directional Sign	Hospital 200m on left	Intersection of	Julian St	& Church St		No change				
	Penola Town Centre													
	Casterton Rd													
519	Green Directional Sign	-37.381531	140.843384	Intersection Sign	Casterton	Southeast bound	Casterton Rd			No change				

520	Green Directional Sign	-37.383559	140.843047	Intersection Sign	Casterton	Southeast bound	Casterton Rd			No change				
521	Green Directional Sign	-37.385801	140.848444	Reassurance Sign	Casterton 58	Southeast bound	Casterton Rd			No change				
522	Various Signs	-37.3855	140.847186	Entry Statement Sign	Welcome to Penola	Northwest bound	Casterton Rd			New Sign	WRC implements the design and installation of secondary and tertiary town entry statements for its smaller villages. Refer to page 66 of WRC Strategy			Medium Priority, Year 2
523	Green Directional Sign	-37.383436	140.842996	Intersection Sign	Town Ctr	Northbound	Casterton Rd			No change				
524	Green Directional Sign	-37.381433	140.843273	Intersection Sign	Town Ctr	Northwest bound	Casterton Rd			No change				
	Casterton Rd													

Wayfound
15 phillimore street
fremantle wa 6160
kim@wayfound.com.au
www.wayfound.com.au
Tel: (08) 9430 4166
ABN: 98 120 289 223

Wayfound WRC719 – 2004222